



Building and Timber Pest Inspection Report VR

Inspection Date: Thu, 11 Dec 2025

Property Address: 20 Hakea Ave, Frenchs Forest NSW 2086,
Australia



Contents

	The Parties
Section A	Results of inspection - summary
Section B	General
Section C	Accessibility
Section D	Significant Items
Section E	Additional comments
Section F	Annexures to this report

Definitions to help you better understand this report

Terms on which this report was prepared

Special conditions or instructions

If you have any queries with this report or require further information, please do not hesitate to contact the person who carried out the inspection.

This Report has been prepared in accordance with the pre-inspection agreement in place between the parties set out below, which set out the purpose and scope of the inspection, and the significant items that will be reported on. This Report reflects the opinion of the inspector based on the documents that have been provided. This Report should be read in its entirety and in the context of the agreed scope of Services. If there is a discrepancy between the summary findings and the body of the Report, the body of the Report will prevail. We recommend that you should promptly implement any recommendation or advice in this Report, including recommendations of further inspections by another specialist. If you have any queries with this Report or require further information, please do not hesitate to contact the person who carried out the inspection. This Report contains reference to material that is the copyright of Standards Australia reproduced under agreement with SAI Global to Jim's Building Inspections (Australia).

Original Inspection Date: Thu, 11 Dec 2025

Modified Date: Fri, 30 Jan 2026

The Parties

Name of the Client:

Name of the Principal(if Applicable):

Job Address: 20 Hakea Ave, Frenchs Forest NSW 2086, Australia

Client's Email Address:

Client's Phone Number:

Consultant: Jas Randhawa Ph: 0432 637 637
Email: Hornsby@jimsbuildinginspections.com.au

Company Name: Jim's Building Inspections Hornsby

Company Address and Postcode: Beecroft 2119

Company Email: Hornsby@jimsbuildinginspections.com.au

Company Contact Numbers: 0432 637 637

Special conditions or instructions

A report may be conditional on information provided by the person, agents or employees of the person requesting the report, apparent concealment of possible defects and a range of other factors

The following apply: A report may be conditional on information provided by the person, agents or employees of the person requesting the report, apparent concealment of possible defects and a range of other factors.

The following apply: This report must be read in conjunction with D5 Conclusion - Assessment of the overall condition of the property. The report must be read in full to clearly understand all items identified as defects in the report.

- This report is based on the condition of the property at the time of inspection. We strongly recommend re-inspection 30 days after this report is issued as the general condition of the property is likely to have changed, including the extent of defects described and instance of potential undetected

defects. The report is only valid for 90 days, where after a re-inspection must take place.

- Where any elevated Structure (deck, balcony, verandah etc) is present, and this elevated structure is designed to accommodate people, you MUST have this structure checked by an engineer or other suitably qualified person.

You should also arrange annual inspections of the structure by an engineer or other suitably qualified person to ensure any maintenance, that may become necessary, is identified. Care must be taken not to overload the structure.

Nothing contained in this report should be taken as an indicator that an assessment has been made, on any elevated structure, as suitable for any specific number of people or purpose. This can only be done by a qualified engineer. For the purpose of this report, the Structure includes elevated decks, verandah, pergolas, balconies, handrails, stairs and children's play areas.

The inspection took place on 11 December 2025. Some photos were taken on 30 January 2026 after the staging. This report is strictly based on the property conditions and defects noted at the time of inspection on 11 of December 2025.

Section A Results of Inspection - summary

A summary of your inspection is outlined below; please also refer to the Report.

	Found	Not Found
Safety Hazard		✓
Major Defect		✓
Minor Defect	✓	
Live Timber Pest Activity		✓
Timber Pest Damage		✓
Conditions Conducive to Timber Pest Activity	✓	
Evidence of fungal decay activity and/or damage		✓
Evidence of wood borer activity and/or damage		✓
Evidence of a previous termite management program		✓

Overall Condition (Building)

In summary, the building, compared to others of similar age and construction is in good condition with some minor defects found.

Overall Condition (Timber Pest)

In summary, the building, compared to others of similar age and construction is highly susceptible to timber pests. A termite treatment is required.

Section B General

General description of the property

Building Type	Residential, Detached
Company or Strata title	No
Floor	Brick Stumps or Piers, Suspended Timber Frame
Furnished	Furnished
No. of bedrooms	4
Occupied	Occupied
Orientation	North West
Other Building Elements	Driveway, Fence - Post and Rail Construction, Footpath, Garage, Pool
Other Timber Bldg Elements	Architraves, Deck, Door Frames, Doors, External Joinery, Internal Joinery, Skirting Boards, Stair Railing, Timber Wall Panelling, Window Frames
Roof	Tiled, Pitched
Storeys	Double
Walls	Brick Veneer (Timber Framed)
Weather	Overcast

Section C Accessibility

Areas Inspected

The following areas were inspected. As documented in your Pre-Inspection Agreement, obstructions and limitations to the accessible areas for inspection are to be expected in any inspection. Refer also to our listing of obstructions and limitations.

- Exterior
- Fencing
- Gardens
- Interior
- Pool Surrounds
- Roof Exterior - Part
- Roof Void - Part
- Stumps
- Subfloor - Part
- The Site
- Wall Exterior

The inspection excludes areas which are affected by obstructions, where access is limited or unsafe. We do not move obstructions and defects, timber pest activity or conditions conducive to these may not be obvious unless they are removed.

Inaccessible Areas

The following areas were inaccessible:

- Ceiling Cavity - Part.
- Exterior Roof Surface - Second Storey.
- Roof Exterior - Part
- Subfloor - Part.
- Wall exterior due to obstructions.

Any areas which are inaccessible at the time of inspection present a high risk for undetected defects and timber pest activity and conditions conducive to these. The client is advised to make inaccessible

areas accessible wherever possible for re-inspection.

Obstructions and Limitations

Building defects, termite and timber pest activity as well as conditions conducive to both, may be concealed by the following obstructions which prevented full inspection:

- Above safe working height
- Appliances and equipment
- Ceiling linings
- Debris in gutters
- Decking
- Duct work
- External concrete or paving
- External finished ground level
- Fixed ceilings
- Fixed Furniture - Built-in Cabinetry
- Floor coverings
- Furniture
- Insulation
- Lack of clearance - subfloor
- Landscaping
- Overhanging vegetation
- Pipework
- Stored items
- Roof framing - not trafficable
- Vegetation
- Wall linings
- Wallpaper or Wall Coverings

The presence of obstructions increases the risk of undetected building defects, timber pest activity and conditions conducive to these. The client should make arrangement to remove obstructions where ever possible and re-inspect these areas urgently.

Undetected defect risk (Building)

A risk rating is provided to help you understand the degree to which accessibility issues and the presence of obstructions have limited the scope of the inspection

The risk of undetected defects is: **Medium**

When the risk of undetected defects is medium or high we strongly recommend further inspection once access is provided or if the obstruction can be removed. Contact us for further advice.

Undetected defect risk (Timber Pest)

A risk rating is provided to help you understand the degree to which accessibility issues and the presence of obstructions have limited the scope of the inspection

The risk of undetected defects is: **High**

When the risk of undetected defects is medium or high we strongly recommend further inspection once access is provided or if the obstruction can be removed. Contact us for further advice.

Section D Significant Items

Safety Hazard

No evidence was found

Major Defect

No evidence was found

Minor Defect

Finding 3.01

Building: Main Building
Location: Garage, Driveway
Finding: Crack in concrete slab - Category 2
Information: A crack coded as Category 2 was identified in the slab. A Category 2 crack is described as a distinct crack, with the slab being noticeably curved or changed in level.

To be considered Category 2, the approximate width of the crack is less than 2.0mm, or a change in offset of less than 15mm when a 3m straight edge is placed over the defect.

Category 2 cracks to slabs should be monitored for a period of 12 months. At the end of the monitoring period, cracks rated greater than Category 2 are considered defects that require rectification.






Finding 3.02

Building: Main Building
Location: All Bathrooms
Finding: Tiles - Cracked/Damaged (VR)
Information: Cracks were noted in the floor tiles at the time of inspection, likely caused by minor settlement or shrinkage. While the cracks are not serious, they may allow water to enter nearby walls or flooring if left unsealed. Replacement of the cracked tiles is recommended at the client's discretion, and a licensed tiler can carry out this work



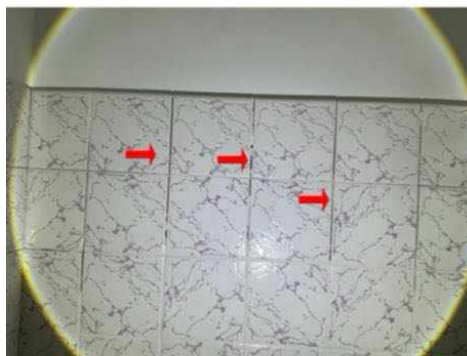

Finding 3.03

Building: Main Building
 Location: Bedroom 1
 Finding: Door Stopper(s) - Missing (VR)
 Information: At the time of inspection, it was noted that a door stopper was missing in this area.

The absence of a door stopper can lead to potential damage to the door, wall, or surrounding finishes, as the door may swing open too far and impact the wall or adjacent objects.

The client is advised to engage services of a handyman to install the door stopper at own discretion.



Finding 3.04

Building: Main Building
 Location: Roof Void
 Finding: Vent - Extracted into Roof Space
 Information: At the time of inspection, it was noted that the exhaust vent terminates into the roof space rather than being ducted outside which is a very common defect. This setup may allow moisture to build up over time, which could affect roof materials if left unaddressed. It is recommended that a licensed electrician re-route the ducting so the

exhaust discharges externally in line with standard building practice.



Finding 3.05

Building:	Main Building
Location:	Roof Exterior
Finding:	Roof Tiles - Weathered (VR)
Information:	At the time of inspection, the roof tiles were noted to be weathered, which is consistent with age and normal exposure to the elements. While no immediate concerns were observed, it is recommended that the roof tiles be monitored and maintained as required to help ensure ongoing weather protection.



Live Timber Pest Activity

No evidence was found

Timber Pest Damage


No evidence was found

Conditions Conducive to Timber Pest Activity

Finding 6.01

Building: Main Building
 Location: Deck, Lower Floor Entrance
 Finding: Bridging or Breaching of Termite Barriers - Adjacent Internal Flooring (VR)
 Information: Bridging occurs when a termite barrier is spanned, while breaching occurs when a hole or gap is present, both of which provide concealed entry points for termites. Where external ground levels are equal to or higher than the internal floor level, the risk of termite activity is increased due to the potential concealment of entry paths.

It is recommended that external ground levels be reduced to ensure they remain below the adjacent internal floor level. Where this is not practical, a licensed pest controller should be engaged to carry out termite treatment around the building perimeter and within the subfloor (if applicable) to minimise the risk of infestation.

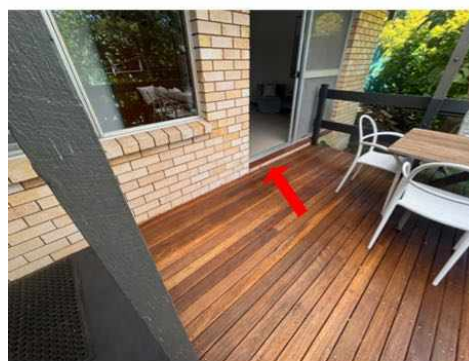

Finding 6.02

Building: Main Building
 Location: Deck
 Finding: Timber Directly Attached to Building & Ground
 Information: At the time of inspection, timber materials were noted to be directly attached to the external wall of the dwelling. This practice is considered a conducive condition for termite activity, as it provides both a potential food source and concealed entry point

for termites into the structure.

It is recommended that the timber be removed, isolated, or appropriately treated to reduce the risk of termite infestation. A licensed pest management specialist should be consulted for further assessment and advice in line with AS 3660.2 (Termite Management).



Finding 6.03

Building: Main Building

Location: Subfloor

Finding: Stored Timbers - On Site

Information: The storage of timber around external areas or within subfloor spaces poses a significant risk of attracting termite activity. Timber left exposed to moisture can develop wood rot, creating an ideal environment for termites and other timber pests. When placed directly on the ground or in damp, concealed subfloor areas, this timber can act as a bridge for termites to enter the structure, potentially causing serious and costly damage.

In addition to termites, stored timber can promote mould, mildew, and fungal growth, which may affect both the structure and the health of occupants.

To reduce these risks, it is strongly advised that any stored timber be removed.



Finding 6.04

Building:	Main Building
Location:	Meter Box
Finding:	Termite Management System - No Evidence of Installation (VR)
Information:	No evidence of a termite management system was identified at the time of inspection. A post-construction chemical termite barrier is strongly recommended to provide long-term protection. The client should consult a licensed pest controller for advice on installation and costs.



Evidence of fungal decay activity and/or damage

No evidence was found

Evidence of wood borer activity and/or damage

No evidence was found

Section D Significant Items

D4 Further Inspections

We advise that you seek additional specialist inspections from a qualified and, where appropriate, licensed

- As identified in summary and defect statements

Jim's Building Inspections can put you in contact with qualified and licensed providers of these and other trades services. Please contact your inspector for recommendations, or visit www.jims.net.

D5 Conclusion - Assessment of overall condition of property

- When evaluated against other properties of similar age and construction type at the time of inspection, the condition of this building is described in detail in Section A – Overall Condition (Building). The risk associated with unidentifiable defects is outlined in Section C – Accessibility: Undetected Defect Risk (Building). This provides a clear assessment of both the current state and potential hidden issues that may not be immediately apparent due to inspection limitations.

The inspection also identified the presence of obstructions, as noted in Section C – Accessibility: Obstructions and Limitations. These obstructions may have restricted the inspector's ability to conduct a comprehensive assessment of certain areas. It is essential to acknowledge that while the inspection was thorough, these limitations may impact the certainty with which hidden defects or potential issues are identified.

Key Findings:

- **Minor Defects:** Specific details of minor defects noted during the inspection are provided throughout the report. These minor defects, while not immediately critical, can potentially develop into major defect if not addressed. Each identified defect should be reviewed individually to understand its nature, potential implications, and the recommended corrective actions. Addressing minor defects promptly helps maintain the building's condition and prevents them from escalating into major repairs or safety issues.

- At the time of inspection, the property was generally assessed to be in good condition for its age, however some minor defects and timber-pest-related issues were identified. These included a Category 2 crack to the concrete slab at the garage/driveway area requiring monitoring, cracked and damaged bathroom floor tiles, missing door stoppers, a bathroom exhaust fan ducted into the roof space rather than externally, weathered roof tiles consistent with age, and a non-functional exhaust fan and missing light cover internally. Conditions conducive to termite activity were noted, including bridging and breaching of termite barriers at the lower deck and adjacent internal flooring, timber elements directly attached to the building and ground, stored timber materials within the subfloor, and the absence of any visible termite management system. While no active termites, timber pest damage, fungal decay, or wood borer activity were observed at the time of inspection, the property was assessed as highly susceptible to timber pests, and a termite treatment and ongoing management

plan is required.

It is imperative that this report be read in full, as every item and defect has been detailed to provide comprehensive insight into the condition of the property. If any clarification is needed on specific defects or sections within the report, please do not hesitate to seek further explanation. This ensures that the client has a complete understanding of the inspection results and can make informed decisions regarding necessary maintenance, repairs, or further expert evaluations.

The report is designed to equip the client with the knowledge needed to maintain the property's structural integrity and value, and to proactively address potential issues to avoid future complications. Regular maintenance and timely attention to the noted defects will contribute significantly to the longevity and safety of the building.

PEST REPORT:

The building when compared to others of similar age is in is in the condition stated in Section A - Overall Condition (Timber Pest) and risk rating of unidentifiable defects is stated in Section C Accessibility - Undetected defect risk (Timber Pest). Obstructions were present as stated in Section C Accessibility - Obstructions and Limitations.

A Timber Pest Management Plan should be implemented and maintained for this property by engaging a Pest Management Technician. A full inspection should be carried out in accordance with AS4349.3 or AS 3660.2 at no more than 12 monthly intervals or as required by the pest management plan. Anew termite treatment is recommended.

This report must be read in full to clearly understand all items identified as defects listed within the report.

Note that if the baths, showers, toilets , vanities, kitchens etc. are not used, or have not been used for some time, moisture readings would not vary significantly and this can lead to erroneous results. It is not possible under the visual inspection criteria (under which a prepurchase inspection is carried out) to categorically determine if there are leaks. If a more accurate assessment is required, a special purpose inspection should be requested. Alternatively, the assumption should be made that the shower may leak.

For further information, advice and clarification please contact Jas Randhawa on: 0432 637 637

Section D Significant Items


The following items were noted as - For your information



Noted Item

Building: Main Building
Location: All External Areas
Finding: Obstructions and Limitations - External Areas
Information: The attached photographs provide a visual representation of the obstructions and limitations that impeded a full inspection of the external areas of the property at the time of assessment. These obstructions, which may include vegetation, stored items, debris, or other physical barriers, can obscure potential defects and prevent a thorough evaluation of the property's condition. Obstructions of this nature can conceal a wide range of issues, such as structural damage, water ingress, pest infestations, or deteriorating building materials, which may not be visible during the initial inspection.

It is essential that these obstructions be cleared to allow for a comprehensive inspection of the external areas. Removing these barriers will enable a more accurate assessment of the property's condition and allow any hidden defects to be identified and addressed promptly. Failure to do so could result in undetected issues worsening over time, potentially leading to more costly repairs in the future.

Therefore, it is strongly recommended that the obstructions be removed and a re-inspection be scheduled once the affected areas are made fully accessible. This will ensure a complete evaluation of the property's exterior and provide the client with a clear understanding of any potential issues that may have been concealed during the initial inspection.

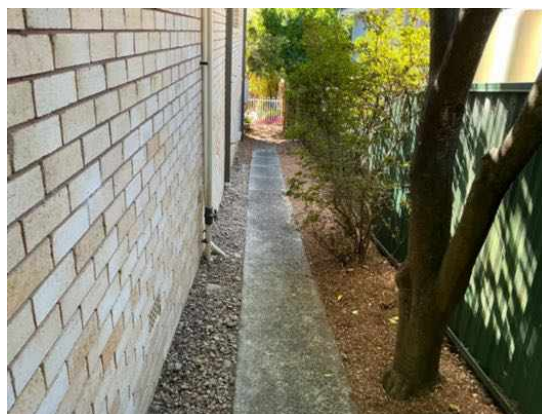

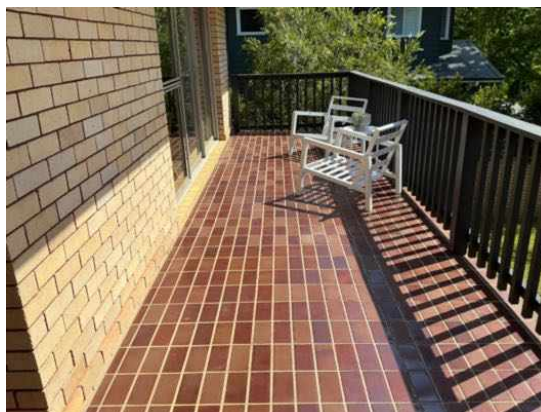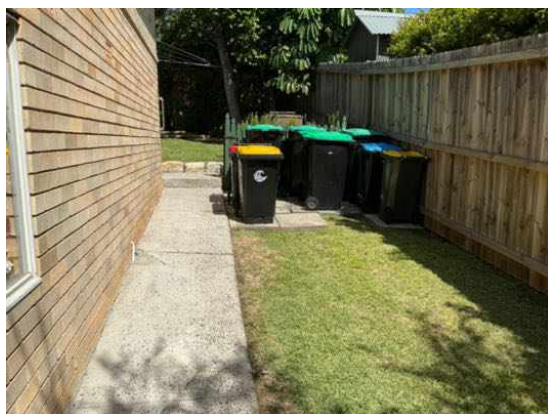

Noted Item

Building: Main Building

Location: All Internal Areas

Finding: Obstructions and Limitations - Internal Areas


Information: The accompanying photographs provide clear evidence of the obstructions and limitations that restricted a comprehensive inspection of the internal areas of the property at the time of assessment. These obstructions, which may include furniture, personal belongings, stored items, or structural elements such as wall coverings and built-ins, significantly hindered the ability to thoroughly evaluate these areas. It is important to note that such obstructions can potentially conceal a wide array of defects, ranging from hidden structural damage, water leaks, pest infestations, or electrical issues, to deteriorating materials that may not be visible during the initial inspection.

The presence of these impediments means that critical areas of the property were not accessible, and therefore, any underlying defects that may affect the integrity and safety of the property could remain undetected. These hidden defects, if left unaddressed, could worsen over time and may result in costly repairs or pose potential safety hazards to the occupants.

It is highly recommended that all obstructions be cleared to facilitate a complete and thorough inspection of the internal areas. Once the obstructions have been removed and full access is available, a re-inspection should be carried out to ensure that any

previously concealed issues can be properly identified and rectified. This follow-up inspection will provide a more accurate assessment of the property's internal condition and help the client make informed decisions about any necessary repairs or maintenance.

In summary, the limitations encountered during the inspection highlight the importance of ensuring full access to all areas of the property to accurately assess its overall condition. A re-inspection is strongly advised once these areas are made accessible.

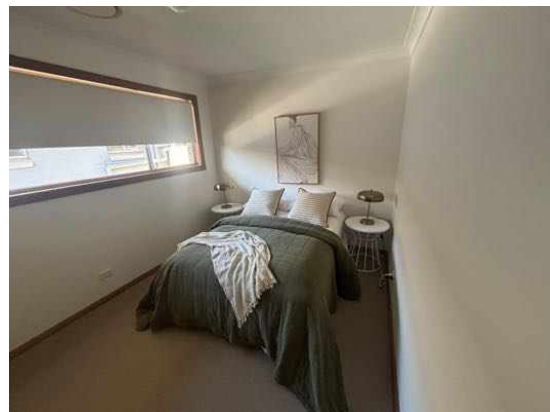






Noted Item

Building:	Main Building
Location:	Roof Void
Finding:	Obstructions, Limitations, and General Roof Space Condition
Information:	The photographs provided document both the general condition and the obstructions and limitations that were present in the roof cavity of the main building at the time of inspection. These obstructions—such as insulation materials, stored items, structural elements, or electrical wiring—restricted safe and adequate access to key areas within the roof space. As a result, a comprehensive inspection of all components could not be completed.

Obstructions of this nature may conceal a variety of potential defects, including damaged framing, compromised insulation, evidence of moisture ingress, pest activity, or electrical hazards. While no major issues were observed in the visible areas, the presence of these limitations means that some defects may remain undetected.

It is recommended that these barriers be removed or repositioned to facilitate full and safe access to the roof space. Once clear, a follow-up inspection should be conducted to allow for a thorough assessment of all concealed areas. This will help ensure that the condition of the roof cavity is accurately evaluated and any hidden issues are appropriately identified and addressed.

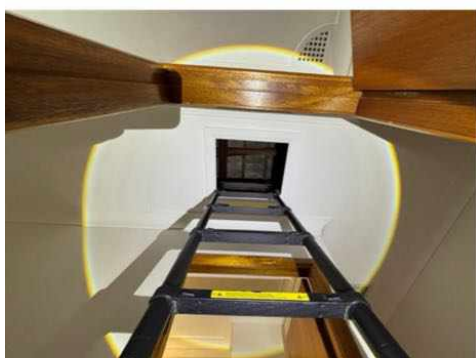




Noted Item

Building: Main Building
Location: Subfloor
Finding: Obstructions, Limitations, and General Subfloor Condition
Information: The attached photographs illustrate the obstructions and access limitations that restricted a full inspection of the subfloor area of the main property at the time of assessment. Items such as stored materials, construction debris, low-hanging services, and insulation impeded movement and visibility within key sections of the subfloor. In addition, the limited crawl height further restricted safe access to inspect critical structural components.

Restricted access and confined spaces can significantly hinder the ability to evaluate important elements such as floor joists, bearers, stumps, drainage, subfloor ventilation, and signs of moisture or pest activity. These obstructions may also conceal defects such as timber decay, water ingress, termite damage, inadequate support, or ventilation issues that are not immediately visible during a limited inspection.

While no major concerns were identified in the accessible areas, a full and unobstructed inspection is necessary to properly assess the overall condition of the subfloor. It is recommended that obstructions be removed and access improved where possible. Once adequate clearance is provided, a re-inspection should be arranged to ensure that any concealed defects can be identified and addressed accordingly. This will assist in providing a more comprehensive understanding of the subfloor's condition and reduce the risk of unforeseen issues.

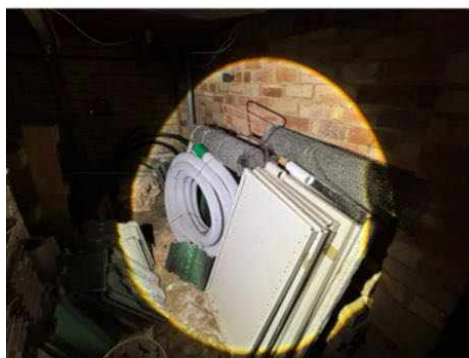





Noted Item

Building:	Main Building
Location:	All Areas
Finding:	FYI - Windows and Doors were tested for Operation
Information:	During the inspection, all accessible windows and doors were tested to assess their functionality. Some windows and doors, however, were locked or obstructed by furniture, personal belongings, or other impediments, which prevented a complete evaluation of these specific units. For those windows and doors that could be tested, they appeared to operate as intended at the time of the inspection, with no immediate concerns noted regarding their opening, closing, or locking mechanisms.

It is important to highlight that, unless specifically identified in separate defect statements, no remedial work is currently deemed necessary for the tested windows and doors. However, for those that were inaccessible or affected by obstructions, their functionality remains undetermined and may require further assessment once access is made available.

Relevant photos of the tested windows and doors, as well as any noted obstructions, may be found in the additional photos section of the report for further reference. To ensure a comprehensive inspection, it is recommended that any locked or obstructed windows and doors be made accessible for re-inspection, allowing for a full evaluation of their condition and functionality. This proactive step will help identify any potential issues that may need addressing and ensure the long-term operational integrity of the windows and doors throughout the property.

Condensation on windows can occur at different times of the year, particularly in colder months or high-humidity environments. While no condensation was visible during the inspection, unless mentioned separately in a defect statement, this does not guarantee it won't occur later under varying conditions. Condensation typically forms when warm, moist air contacts cooler window surfaces, potentially leading to mould, wood rot, or damage to frames and seals. To reduce condensation risks, ensure proper ventilation in moisture-prone areas like kitchens and bathrooms, and monitor windows throughout the year to address any issues that may arise.

Noted Item

Building:	Main Building
Location:	All Areas
Finding:	FYI - Plumbing and Electrical - Outside of the scope of this inspection
Information:	Plumbing and electrical inspections fall outside the scope of a standard building inspection and must be conducted by a licensed and registered tradesperson with the appropriate qualifications. While the building inspection may highlight visually apparent defects related to plumbing, electrical, and gas systems, it is important to understand that compliance with relevant safety standards and regulations can only be confirmed through a detailed inspection carried out by qualified electricians and plumbers. Legislation requires that these professionals check, document, and certify the compliance of these systems to ensure they are functioning safely and efficiently.

Given the importance of properly functioning plumbing, electrical, and gas systems, it is highly recommended that the client arranges for a comprehensive inspection by licensed tradespeople. This will not only ensure that the systems are working correctly but will also help identify any underlying safety issues that may not be visible during a general building inspection. By doing so, the client can mitigate the risks of potential hazards, avoid costly repairs in the future, and ensure that the property's systems meet the required safety standards.

Noted Item

Building:	Main Building
Location:	Pool Area
Finding:	FYI - Pool Area
Information:	This inspection explicitly excludes any assessment of the pool, spa, associated pool equipment, and the surrounding areas. As a standard building inspection does not encompass these elements, it is crucial for the client to understand that no evaluation has been conducted regarding the condition, functionality, or safety compliance of the pool or its associated systems. This includes, but is not limited to, pumps, filters, heating equipment, and structural integrity of the pool or spa surrounds.

To gain a comprehensive understanding of the condition and compliance of these components, it is highly recommended that the client engages a specialist pool inspector. A pool inspection will evaluate the structural condition of the pool, ensure the functionality of all associated equipment, and assess whether the pool and its surroundings meet current safety regulations. In particular, pool safety requirements, including fencing and access controls, are subject to stringent regulatory standards, which must be verified separately by a qualified pool inspector.

It is important to note that a pool safety inspection, which is crucial to ensure compliance with legal safety standards, is not part of a standard building inspection and must be commissioned separately. Engaging a licensed pool inspector ensures

that any potential safety hazards or functional defects are identified and addressed in a timely manner, safeguarding the well-being of the occupants and ensuring compliance with relevant legislation.




Noted Item

Building:	Main Building
Location:	All Areas
Finding:	FYI - Taps, Drainage & Toilets Tested and Cabinetry Obstructions
Information:	During the inspection, all accessible taps, drainage systems, and toilets were tested for water flow and drainage efficiency, and checked for any visible signs of leakage. At the time of the inspection, no issues were noted in these areas. Unless highlighted in a separate defect statement, no immediate remedial work appears necessary. Supporting images may be found in the additional photos section for reference.

It is important to note that while a visual inspection of cupboards and cabinetry beneath sinks and vanities was undertaken, stored personal items and fixtures presented obstructions that limited full visibility of the internal areas. As per standard inspection practices, inspectors are not permitted to move or disturb personal belongings during the inspection process. Therefore, only visible and accessible sections were inspected, and concealed water damage or plumbing defects may not have been detected.

Given this, a re-inspection is recommended after all obstructions have been cleared to allow for a comprehensive assessment of these areas. Regular maintenance and monitoring of plumbing and drainage systems is also advised to ensure ongoing functionality and early detection of potential issues.

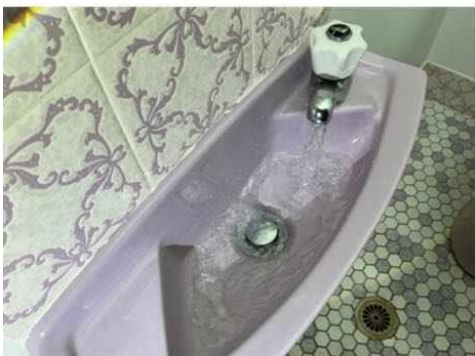





Noted Item

Building: Main Building
 Location: All Areas
 Finding: Additional Photos - Moisture Meter Readings (VR)
 Information: Moisture meter readings were taken at various locations throughout the property during the inspection. All readings were within the normal range, and no elevated moisture levels were detected at the time of assessment. Additional photos have been provided to show the specific areas tested for further clarity.


It is important to note that moisture levels can fluctuate over time due to weather, humidity, and environmental conditions. While readings were normal during the inspection, future changes may still result in dampness, mould growth, or deterioration of building materials if left unmonitored. Any defects relating to moisture have been detailed separately in the defect statements within this report.

The client is encouraged to monitor moisture-prone areas regularly, particularly during wet seasons or periods of high humidity, and to contact the inspector directly for clarification or further advice if required.







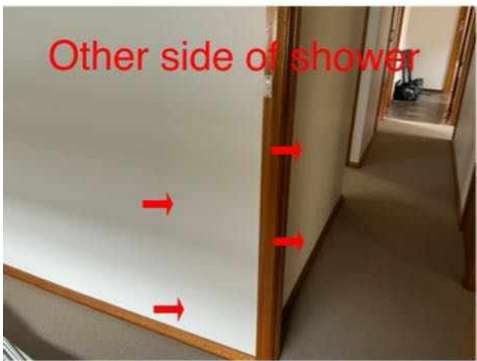















Noted Item

Building: Main Building

Location: Roof Exterior

Finding: Additional Roof Photos

Information: As part of the information provided, please note that the attached roof photos represent the condition of the roof at the time of inspection. These photos are for visual reference only and do not constitute a detailed roofing assessment. Any defects or issues identified with the roof are mentioned separately in the defect statements. It is strongly recommended that the client engage a qualified roofer to conduct a thorough inspection of the roof, ensuring that any potential issues, such as leaks, structural integrity, or wear and tear, are properly identified and addressed.

Additionally, the condition of the roof may change over time due to weather, natural wear, or other unforeseen factors. Regular maintenance and inspections by a licensed professional are advised to ensure the roof remains in good condition and to avoid costly repairs in the future. The information provided in these photos should be considered a snapshot of the roof's condition during the time of inspection and not a guarantee of its future performance.





Noted Item

Building: Main Building
 Location: Meter Box
 Finding: Termite Management Recommendation – No Evidence of Chemical Installation (VR)
 Information: At the time of inspection, there was no visible evidence of a chemical termite management system installed around the property. Chemical barriers are a key component of termite protection and are particularly important in preventing concealed termite entry into timber elements of the structure.

In accordance with standard requirements, a durable notice should be located within the electrical switchboard to detail any termite protection systems applied, including chemical treatments. No such notice was observed during the inspection.

It is recommended that the client engage a licensed pest controller to carry out chemical termite treatment.



Noted Item

Building: Main Building
 Location: Meter Box
 Finding: Subterranean Termite Management Proposal (VR)
 Information: In accordance with Australian Standard AS 3660, a comprehensive termite treatment

proposal is recommended for any property with evidence of termite activity. Effective management should include addressing conducive conditions (such as timber in contact with soil, excess moisture, and unsealed gaps), the use of baiting systems or direct treatment of live colonies, and the installation of a chemical barrier around the perimeter for long-term protection.

Engaging a licensed pest control professional to prepare and implement this proposal will ensure compliance with standards and provide tailored, sustainable protection. Ongoing monitoring and periodic treatments are strongly advised to safeguard the property's structural integrity and prevent costly damage.

Noted Item

Building:	Main Building
Location:	Bathroom Lower Floor
Finding:	Non Functional Exhaust Fan
Information:	At the time of inspection, one exhaust fan was noted to be non-operational and missing its cover. It was also observed that another exhaust fan in the same area was functioning as intended. As the non-working fan is not required, it is recommended that a licensed electrician remove the unused fan and make good the opening for a neat and finished appearance.



Noted Item

Building:	Main Building
Location:	Hallway
Finding:	Light Cover - Missing
Information:	At the time of inspection, it was observed that the light cover for the ceiling light fixture is missing. The absence of the light cover exposes the bulbs and internal components. It is recommended to replace the missing light cover promptly to ensure safety and restore the visual integrity of the lighting fixture.



Definitions to help you better understand this report

Access hole (cover)	An opening in flooring or ceiling or other parts of a structure (such as service hatch, removable panel) to allow for entry to carry out an inspection, maintenance or repair.
Accessible area	An area of the site where sufficient, safe and reasonable access is available to allow inspection within the scope of the inspection.
Appearance defect	Fault or deviation from the intended appearance of a building element.
Asbestos-Containing Material (ACM)	Asbestos-containing material (ACM) means any material or thing that, as part of its design, contains asbestos.
Building element	A portion of a building that, by itself or in combination with other such parts, fulfils a characteristic function. NOTE: For example supporting, enclosing, furnishing or servicing building space.
Client	The person or other entity for whom the inspection is being carried out.
Conditions Conducive to Termite Activity	Noticeable building deficiencies or environmental factors that may contribute to the presence of Termites.
Defect	Fault or deviation from the intended condition of a material, assembly, or component.
Detailed assessment	An assessment by an accredited sampler to determine the extent and magnitude of methamphetamine contamination in a property.
Inspection	Close and careful scrutiny of a building carried out without dismantling, in order to arrive at a reliable conclusion as to the condition of the building.
Inspector	Person or organisation responsible for carrying out the inspection.
Instrument Testing	Where appropriate the carrying out of Tests using the following techniques and instruments: (a) electronic moisture detecting meter - an instrument used for assessing the moisture content of building elements (b) stethoscope - an instrument used to hear sounds made by termites within building elements (c) probing - a technique where timber and other materials/areas are penetrated with a sharp instrument (e.g. bradawl or pocket knife), but does not include probing of decorative timbers or finishes, or the drilling of timber and trees and (d) sounding - a technique where timber is tapped with a solid object. (e) T3I - an instrument used to detect movement, moisture and changes in temperature within timber
Limitation	Any factor that prevents full or proper inspection of the building.
Major defect	A defect of sufficient magnitude where rectification has to be carried

	out in order to avoid unsafe conditions, loss of utility or further deterioration of the property.
Methamphetamine	An amphetamine-type stimulant that is highly addictive. Methamphetamine is a controlled substance, classified as a Class A (very high-risk) drug under the Misuse of Drug Act. This term is used as a grouping term to include all substances screened for, specifically: Ephedrine, Pseudoephedrine, Amphetamine, Methamphetamine, MDA and MDMA.
Methamphetamine contamination	A property or part of a property where the level of methamphetamine has been tested in accordance with this standard and found to exceed 0.5 micrograms/100 cm ² (Residential) or 10 micrograms/100 cm ² (Commercial).
Methamphetamine production/manufacture	The manufacture of methamphetamine, including processing, packaging, and storage of methamphetamine and associated chemicals.
Minor defect	A defect other than a major defect.
Roof space/Roof void	Space between the roof covering and the ceiling immediately below the roof covering.
Screening assessment	An assessment by a screening sampler to determine whether or not methamphetamine is present.
Serviceability defect	Fault or deviation from the intended serviceability performance of a building element.
Significant item	An item that is to be reported in accordance with the scope of the inspection.
Site	Allotment of land on which a building stands or is to be erected.
Structural defect	Fault or deviation from the intended structural performance of a building element.
Structural element	Physically distinguishable part of a structure. NOTE: For example wall, columns, beam, connection.
Subfloor space	Space between the underside of a suspended floor and the ground.
Subterranean Termite Management Proposal	A written proposal in accordance with Australian Standard AS 3660.2 to treat a known subterranean termite infestation and/or manage the risk of concealed subterranean termite access to buildings and structures.
Termites	Wood destroying insects belonging to the order 'Isoptera' which commonly attack seasoned timber.
Tests	Additional attention to the visual examination was given to those accessible areas which the consultant's experience has shown to be

particularly susceptible to attack by Termites. Instrument Testing of those areas and other visible accessible timbers/materials/areas showing evidence of attack was performed.

Timber Pest Activity	Tell-tale signs associated with 'active' (live) and/or 'inactive' (absence of live) Timber Pests at the time of inspection.
Timber Pest Attack	Timber Pest Activity and/or Timber Pest Damage.
Timber Pest Damage	Noticeable impairments to the integrity of timber and other susceptible materials resulting from an attack by Timber Pests.
Urgent and Serious Safety Hazards	Building elements or situations that present a current or immediate potential threat of injury or disease to persons.

Terms on which this report was prepared

This report is based on the condition of the property at the time of inspection. We strongly recommend re-inspection 30 days after this report is issued as the general condition of the property is likely to have changed, including the extent of defects described and instance of potential undetected defects.

This report has been prepared in accordance with and subject to the pre-inspection agreement in place between the parties, which forms part of this Report.

This Report is prepared for the client identified above and may not be relied on by any other person without our express permission or by the purchase of this Report on our website.

SPECIAL ATTENTION SHOULD BE GIVEN TO THE SCOPE, LIMITATIONS AND EXCLUSIONS IN YOUR PRE-INSPECTION AGREEMENT AND THIS REPORT

Any of the exclusions or limitations identified for this Report may be the subject of a special-purpose inspection which we recommend being undertaken by an appropriately qualified inspector

RELIANCE AND DISCLOSURE

This report has been prepared based on conditions at the time of the report.

We own the copyright in this report and may make it available to third parties.

If your Property is in the Australian Capital Territory, you acknowledge we will make certain information about this Report available to the ACT Government for inclusion in the building and pest inspections public register if required under the *Civil Law (Sale of Residential Property) Act 2003*. This will include the fact the report has been prepared, the Property street address, date of the inspection, the name of the person who prepared the report and (if applicable) the entity that employs them.

UNDETECTED DEFECT RISK RATING

If this Report has identified a medium or high-risk rating for undetected defects, we strongly recommend a further inspection of areas that were inaccessible. This may include an invasive inspection that requires the removal or cutting of walls, floors or ceilings.

If the Property has been vacant for a period of time, moisture levels or leaks may not be detectable at the time of the inspection because often only frequent use of water pipes (showers, taps etc) result in a leak being identifiable. We advise further testing on pipes and water susceptible areas (such as the bathroom and laundry) after more frequent use has occurred.

IMPORTANT SAFETY INFORMATION:

This is not a report by a licensed plumber or electrician. We recommend a special-purpose

report to detect substandard or illegal plumbing and electrical work at the Property

This is not a smoke alarm report. We recommend all existing detectors in the Property be tested and advice sought as to the suitability of number, placement and operation.

This is not an asbestos report. There are potential products in the Property containing asbestos that will not be identified in this report. In order to accurately identify asbestos, we recommend performing an asbestos inspection, particularly for buildings built prior to 1988.

This is not a report on safety glass. Glazing in older homes may not reflect current standards and may cause significant injury if damaged. Exercise caution around the glass in older homes.

This is not a report on window opening restrictions. We have not inspected window opening restrictors. Window openings in older buildings may not reflect current standards and can be a potential risk. Window opening restrictors are advised for all second story or above windows with sill heights below 900mm. Some states make this a mandatory requirement. Owners should enquire of their local and state requirements to ensure compliance.

This is not a report on pool safety. If a swimming pool is present it should be the subject to a special purpose pool inspection.

External Timber Structures - Balcony and Decks. It is strongly recommended that a Structural Engineer is required to assess distributed load capacity of external timber structures such as balconies and decks, alerting users of the load capacity. Regular maintenance and inspections by competent practitioners to assess the ongoing durability of exposed external timber structures are needed.

This is not a Group Titled Property Report as per AS4349.2. If you require a report for a Group Titled Property as per this standard, please seek a separate inspection for Group Titled Properties.

MOISTURE

The identification of moisture, dampness or the evidence of water penetration is dependent on the weather conditions at the time an inspection. The absence of dampness identified in this Report does not necessarily mean the Property will not experience some damp problems in other weather conditions or that roofs, walls or wet areas are watertight.

Where the evidence of water penetration is identified we recommend detailed investigation of waterproofing in the surrounding area monitoring of the affected area over a period of time to fully detect and assess the cause of dampness.

MAINTENANCE OF THE PROPERTY

This Report is not a warranty or an insurance policy against problems developing with the Property in the future. Accordingly, a preventative maintenance program should be implemented which includes systematic inspections, detection and prevention of issues. Please contact the inspector who carried out this inspection for further advice.

It is strongly advised that appropriate steps be taken to remove, rectify or monitor any evidence of

conditions conducive to timber pest activity. Undertaking thorough regular inspections at intervals not exceeding twelve months (or more frequent inspections where the risk of timber pest attack is high or the building type is susceptible to attack). To further reduce the risk of subterranean termite attack, implement a management program in accordance with Australian Standard AS3660. This may include the installation of a monitoring and/or baiting system, or chemical and/or physical barrier. However, AS3660 stresses that subterranean termites can bridge or breach barrier systems and inspection zones and those thorough regular inspections of the building are necessary.

NO CERTIFICATION

- a) The Property has been compared to others of a similar age, construction type and method that had an acceptable level of basic maintenance completed.
- b) We don't advise you about title, ownership or other legal matters like easements, restrictions, covenants and planning laws. None of our inspections constitutes approval by a Building Surveyor, a certificate of occupancy or compliance with any law, regulation or standard, including any comment on whether the Property complies with current Australian Standards, Building Regulations or other legislative requirements.

RECTIFICATION COSTS

We don't provide advice on the costs of rectification or repair unless specifically identified in the scope of the Report. Any cost advice provided verbally or in this report must be taken as of a general nature and is not to be relied on. Actual costs depend on the quality of materials, the standard of work, what price a contractor is prepared to do the work for and may be contingent on approvals, delays and unknown factors associated with third parties. No liability is accepted for costing advice.