



Building and Timber Pest Inspection Report

Inspection Date: Wed, 25 Feb 2026

Property Address: 2 Wilgah St, St Kilda East VIC 3183,
Australia



Contents

	The Parties
Section A	Results of inspection - summary
Section B	General
Section C	Accessibility
Section D	Significant Items
Section E	Additional comments
Section F	Annexures to this report

Definitions to help you better understand this report

Terms on which this report was prepared

Special conditions or instructions

If you have any queries with this report or require further information, please do not hesitate to contact the person who carried out the inspection.

This Report has been prepared in accordance with the pre-inspection agreement in place between the parties set out below, which set out the purpose and scope of the inspection, and the significant items that will be reported on. This Report reflects the opinion of the inspector based on the documents that have been provided. This Report should be read in its entirety and in the context of the agreed scope of Services. If there is a discrepancy between the summary findings and the body of the Report, the body of the Report will prevail. We recommend that you should promptly implement any recommendation or advice in this Report, including recommendations of further inspections by another specialist. If you have any queries with this Report or require further information, please do not hesitate to contact the person who carried out the inspection. This Report contains reference to material that is the copyright of Standards Australia reproduced under agreement with SAI Global to Jim's Building Inspections (Australia).

Original Inspection Date: Wed, 25 Feb 2026

The Parties

Name of the Client:

Name of the Principal(If Applicable):

Job Address: 2 Wilgah St, St Kilda East VIC 3183, Australia

Client's Email Address:

Client's Phone Number:

Consultant: Shubham Patil Ph: 0452 035 252
Email: Altona@jimsbuildinginspections.com.au

Company Name: Jim's Building Inspections (Altona)

Company Address and Postcode: Tarneit 3029

Company Email: Altona@jimsbuildinginspections.com.au

Company Contact Numbers: 0452 035 252

Special conditions or instructions

A report may be conditional on information provided by the person, agents or employees of the person requesting the report, apparent concealment of possible defects and a range of other factors

The following apply: In the event where the property is classified in a poor condition or has numerous defects. It's highly recommended to get the exact quotes for rectification works from relevant tradesman prior to proceeding with the sale.

Please refer back to your conveyancer to procure any kinds of permits/documents relevant for additional structures built (pergolas, sheds etc) or to procure more information on body corp fees, upcoming schedule of maintenance works, sinking fund etc.

To avoid termite ingress/ damage to the property, consider doing termite treatment as soon as possible if one is not already present. Annual pest inspections are highly recommended as well by a licensed termite technician. This course of preventive measures is highly recommended for all

properties. However, it is a must for all properties in termite prone areas or properties older than 15 years old.

Issues categorised as moderately significant have the potential to turn into a major defect. If the moderately significant issue is categorised in the major section, then it's an indication that it's very close to being a major issue.

All showers & taps are kept running for atleast 10-15 minutes to check for any potential leaks.

Section A Results of Inspection - summary

A summary of your inspection is outlined below; please also refer to the Report.

	Found	Not Found
Safety Hazard		✓
Major Defect	✓	
Minor Defect	✓	
Live Timber Pest Activity		✓
Timber Pest Damage		✓
Conditions Conducive to Timber Pest Activity	✓	
Evidence of fungal decay activity and/or damage	✓	
Evidence of wood borer activity and/or damage		✓
Evidence of a previous termite management program		✓

Overall Condition (Building)

In summary, the building, compared to others of similar age and construction is in fair condition with some major and minor defects found.

Overall Condition (Timber Pest)

In summary, the building, compared to others of similar age and construction is highly susceptible to timber pests. A termite treatment is required.

Section B General

General description of the property

Building Type	Residential
Company or Strata title	Unknown
Floor	Stumps, Masonry Piers, Part Slab and Part Subfloor
Furnished	Furnished
No. of bedrooms	2
Occupied	Unoccupied
Orientation	South West
Other Building Elements	Fence - Post and Rail Construction
Other Timber Bldg Elements	Skirting Boards, Landscaping Timbers and Construction, Doors, Architraves
Roof	Tiled, Timber Framed, Corrugated Iron (e.g. Colourbond)
Storeys	Single
Walls	Brick Veneer (Timber Framed)
Weather	Fine

Section C Accessibility

Areas Inspected

The following areas were inspected. As documented in your Pre-Inspection Agreement, obstructions and limitations to the accessible areas for inspection are to be expected in any inspection. Refer also to our listing of obstructions and limitations.

- Roof Void - Part
- Roof Exterior - Part
- Interior
- Exterior

The inspection excludes areas which are affected by obstructions, where access is limited or unsafe. We do not move obstructions and defects, timber pest activity or conditions conducive to these may not be obvious unless they are removed.

Inaccessible Areas

The following areas were inaccessible:

- Wall Exterior - where neighbouring buildings immediately adjoin.
- Roof Exterior - Part
- Subfloor due to lack of access.

Any areas which are inaccessible at the time of inspection present a high risk for undetected defects and timber pest activity and conditions conducive to these. The client is advised to make inaccessible areas accessible wherever possible for re-inspection.

Obstructions and Limitations

Building defects, termite and timber pest activity as well as conditions conducive to both, may be concealed by the following obstructions which prevented full inspection:

- Evidence of recently painted walls or ceilings
- External finished ground level
- Fixed Furniture - Built-in Cabinetry
- Furniture
- Lack of clearance - subfloor

The presence of obstructions increases the risk of undetected building defects, timber pest activity and conditions conducive to these. The client should make arrangement to remove obstructions where ever possible and re-inspect these areas urgently.

Undetected defect risk (Building)

A risk rating is provided to help you understand the degree to which accessibility issues and the presence of obstructions have limited the scope of the inspection

The risk of undetected defects is: **High**

When the risk of undetected defects is medium or high we strongly recommend further inspection once access is provided or if the obstruction can be removed. Contact us for further advice.

Undetected defect risk (Timber Pest)

A risk rating is provided to help you understand the degree to which accessibility issues and the presence of obstructions have limited the scope of the inspection

The risk of undetected defects is: **High**

When the risk of undetected defects is medium or high we strongly recommend further inspection once access is provided or if the obstruction can be removed. Contact us for further advice.

Section D Significant Items

Safety Hazard



No evidence was found

Major Defect

Finding 2.01

Building:	Main Building
Location:	Bedroom 2 & Roof exterior.
Finding:	Water ingress & Associated Roofing issues.
Information:	<p>Water staining and damage were identified to the ceiling/wall area within Bedroom 2. This was confirmed visually (physical staining), instrument tested (elevated moisture readings recorded via moisture meter), and supported by thermal imaging, which showed abnormal temperature patterns consistent with retained moisture within the lining/cavity. Although the exact entry point could not be verified because no direct roof-void access was available above this area at the time of inspection, the findings are consistent with active or intermittent water ingress and should be treated as a major defect due to the risk of ongoing deterioration (plaster breakdown, mould growth, timber decay/rot to concealed framing, and progressive internal damage).</p>

The most likely contributing factors were observed at the roof level. While the roof covering itself did not present as catastrophic, it displayed multiple defects that materially increase the likelihood of leaks, including rusted valley flashings (with evidence of prior patch repairs), deteriorated/cracked mortar to ridge/hip bedding and pointing, and blocked/contaminated gutters with debris that can cause overflow and backflow beneath tiles during rainfall. Collectively, these conditions reduce the roof's weatherproofing reliability and provide plausible leak pathways consistent with the internal moisture findings. Urgent investigation and rectification by a qualified roofing contractor is recommended, including leak tracing (ideally during/after rainfall), clearance of gutters, and targeted repairs/replacement to valley flashings and defective mortar areas, followed by reinstatement/repair of affected internal linings once the moisture source is confirmed resolved.

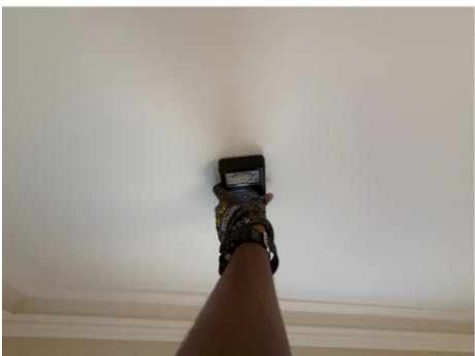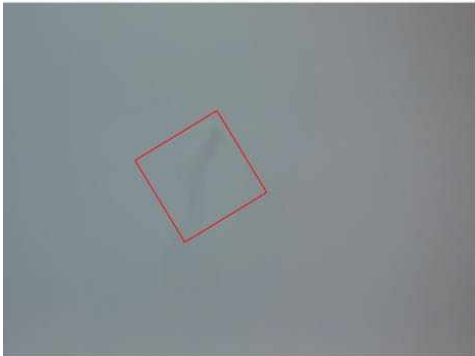





Minor Defect





Finding 3.01

Building:	Main Building
Location:	Exterior walls - right side
Finding:	Mortar Deterioration (Moderately Significant)
Information:	The external brickwork mortar joints display age-related deterioration, with multiple sections observed to be loose, powdery, eroded and locally recessed beyond typical weathering tolerances. This condition is consistent with long-term exposure and natural binder breakdown; however, the inconsistent joint hardness and variable finish

may also indicate substandard mortar mix ratios or workmanship in certain areas. Localised patch repairs are evident but appear limited in extent and do not comprehensively address the broader deterioration. Progressive mortar loss can increase moisture penetration, reduce lateral bond between bricks, and accelerate brick arris fretting over time.

Consultation with a qualified bricklayer is recommended to assess the extent of joint degradation and determine whether staged or full elevation repointing is required in the medium term to restore overall integrity and durability of the masonry.



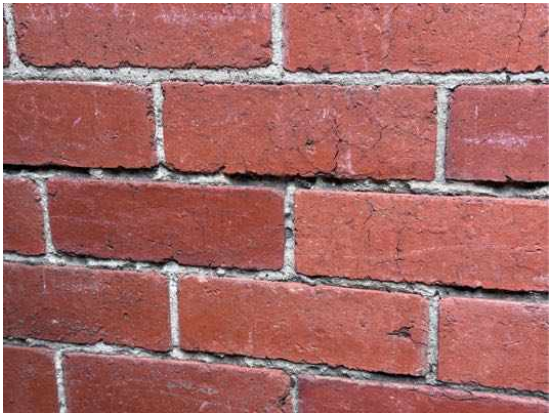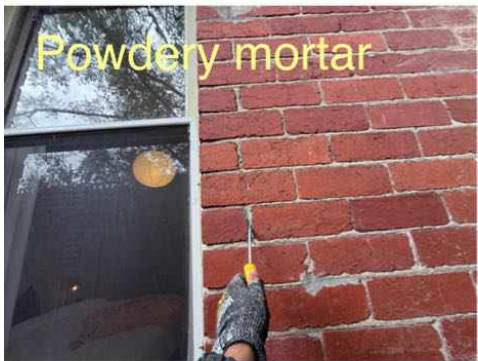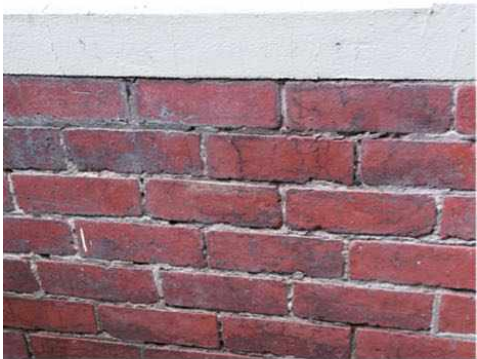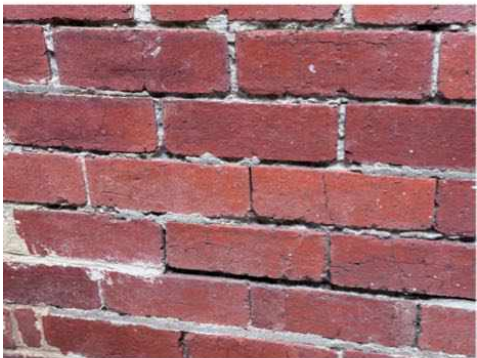



Finding 3.02

Building:	Main Building
Location:	Exterior walls - rear
Finding:	Cracked Glazing Panel
Information:	A crack was observed to the lower section of the fixed glass panel adjacent to the living/kitchen area. The crack appears localised and no immediate failure of the pane was noted at the time of inspection. While currently intact, cracked glazing can progressively weaken and may be susceptible to further spreading due to thermal movement, impact, or structural vibration.

It is recommended that the glazing be monitored in the short term and if necessary be assessed by a qualified glazier, with replacement undertaken as required to maintain safety and integrity of the window system.




Finding 3.03

Building:	Main Building
Location:	Some external Areas
Finding:	Brickwork - Cracking [Fine]
Information:	Although fine cracks are quite noticeable, they are often only considered to be an appearance defect and usually do not indicate any structural damage. Generally, the cause of a fine crack is indicative of a separation between brickwork and mortar

throughout the structure, but single bricks may also show cracks of this nature.

Cracking of this nature can generally be repaired with minor filling and should be conducted by a qualified bricklayer.

Always contact a building inspector should cracks widen lengthen or become more numerous.

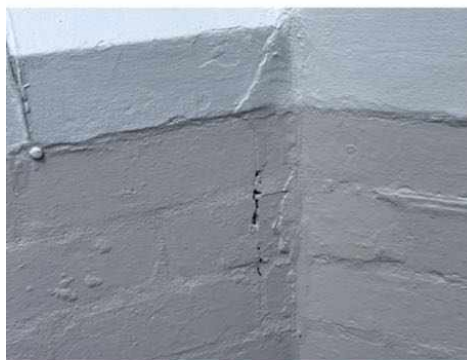

Finding 3.04

Building:	Main Building
Location:	Roof Exterior
Finding:	Roof Tiles Covered with Moss and Lichen Growth
Information:	The roof tiles are observed to be covered with moss and lichen. This biological growth can retain moisture against the tile surface, potentially accelerating tile degradation, loosening of fixings, and increasing the risk of water ingress over time.

At clients discretion roof tiles can be cleaned using a low-pressure wash or a suitable biocide treatment to remove the moss and lichen without damaging the tiles. Following cleaning, a roof inspection should be carried out to assess for any cracked, dislodged, or deteriorated tiles, with necessary repairs or replacements undertaken. Preventive maintenance such as improving roof ventilation and trimming overhanging branches can also help reduce regrowth.



Finding 3.05

Building:	Main Building
Location:	Laundry
Finding:	Missing Cap Below Laundry Tap
Information:	The plumbing beneath the laundry sink is missing a cap/plug on one of the outlet connections of the waste pipe. When the tap is turned on, water escapes directly from the uncapped opening, leaking into the cabinet area below. This can cause water damage and swelling to the cabinet base panel.

This condition is classified as a defect as it allows uncontrolled water discharge, leading to deterioration of joinery materials, potential mould growth, and further water-

related damage if left untreated. Immediate rectification is recommended by sealing the opening with an appropriate cap or connection piece to prevent further leakage and damage.



Finding 3.06


Building:	Main Building
Location:	Some Internal Areas
Finding:	Subsidence- moderately significant
Information:	It is suspected that the subfloor structure might have been affected by movement of the foundations, often referred to as sinking or subsidence.


General subsidence is usually initiated by changes in soil moisture content. The most critical factor is identifying the specific causes, and identifying if this is a recurring or ongoing problem, or one that has been resolved by previous works in the past. The max documented deviation was around 25-30 mm in 2 m distance.

Subsidence can have complex and varying causes, which will influence the required remedial works. If secondary defects like door binding, cracks around the cornices, or gaps between walls & flooring are evident. It will be advised to begin by consulting a structural engineer to determine the required scope of works. This generally includes some form of underpinning, as well as addressing the underlying cause.

A Registered Builder specialising in re-stumping would then generally carry out works

as advised by an Engineer.

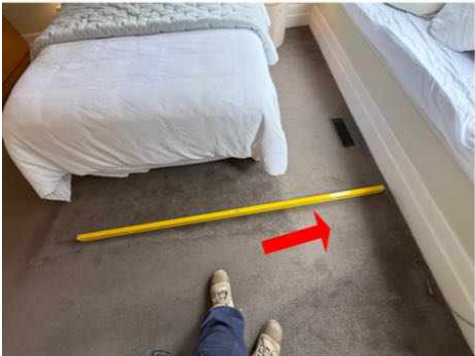

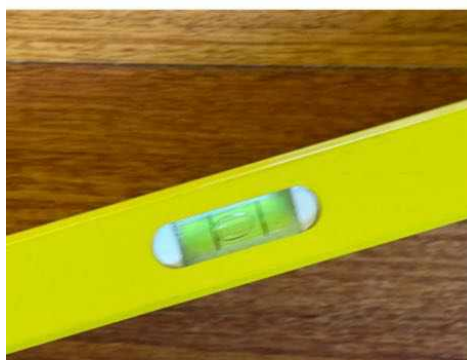


Finding 3.07

Building:	Main Building
Location:	Some Internal Areas
Finding:	Cracking - Damage Category 1 - Fine (up to 1mm)
Information:	Although fine cracks are quite noticeable, they are often only considered to be an appearance defect, and usually do not indicate any structural damage. Generally, the cause of a fine crack is indicative of a separation between building materials and finishes (e.g. paint, plaster, etc.) along joins.

Cracking of this nature can generally be repaired with minor sanding, filling and/or repainting. Such works should be performed by a qualified painter or a general handyman.

Monitoring of all cracking should be conducted frequently. Always contact a building inspector should cracks widen, lengthen, or become more numerous.



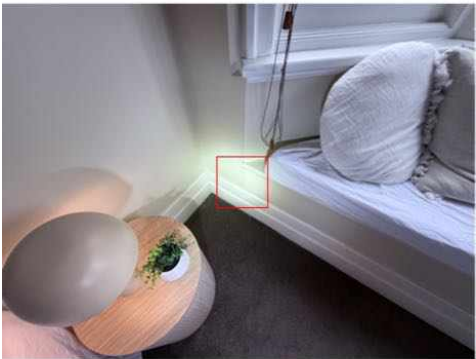

Finding 3.08

Building: Main Building
Location: Kitchen
Finding: Kitchen Cabinet Swelling
Information: Localised swelling and surface deterioration were observed to the kitchen cabinet base panel beneath the sink area. The board shows signs of past moisture exposure, resulting in deformation and edge lifting. At the time of inspection, no active plumbing leaks or moisture ingress were detected. The condition appears historical; however, continued monitoring is recommended, and damaged sections may be repaired or replaced in the medium term to prevent further deterioration.



Finding 3.09

Building:	Main Building
Location:	Kitchen
Finding:	Swelling to Skirting Boards
Information:	Localized swelling and minor paint deformation were observed to sections of the skirting boards, particularly near floor junctions and doorway transitions. The condition is consistent with past or intermittent moisture exposure and/or minor impact damage, resulting in slight expansion of the timber substrate. No significant structural impact was evident at the time of inspection; however, continued moisture exposure may lead to further deterioration or paint failure. Monitoring is recommended, and affected sections should be sanded, sealed and repainted once the moisture source (if any) is addressed.



Finding 3.10

Building: Main Building
Location: Exterior walls - rear
Finding: Surface Mould
Information: Where evidence of mould growth was noted, the client is advised to ensure that the general environment is free of moisture and humidity to aid in the prevention of mould formation and development. Any mould found during the inspection should be cleaned immediately by a cleaning contractor or the homeowner as applicable.



Finding 3.11

Building:	Main Building
Location:	Bathroom/ laundry
Finding:	Grout - Missing
Information:	Grout is missing in this area. Grout is used to protect gaps and crevices in building materials to ensure that they are water-tight and prevent water penetration to the associated structures.

Where grout is missing, a tiling contractor should be appointed immediately to apply grout and re-apply any silicone where necessary. Failure to do so is likely to lead to water damage to the surrounding area.



Live Timber Pest Activity

No evidence was found

Timber Pest Damage

No evidence was found

Conditions Conducive to Timber Pest Activity

Finding 6.01

Building:	Main Building
Location:	Meter Box
Finding:	Termite Management System - no evidence of a chemical installation
Information:	The application of a post-construction chemical termite barrier is highly recommended for all properties, particularly if live termite activity has been found on the site previously. Such barriers are highly effective in preventing termite attack on any timber building elements throughout the property.

A durable notice should be placed in the switchboard unit to indicate current termite barriers. At the time of inspection, it appeared as though no termite management

system has been installed, with no evidence to suggest preventative works taking place.

The client may consider gaining further advice from a pest controller as to the costs and procedures involved with this application. It is recommended that obtaining such advice be a short-term priority.



Finding 6.02

Building: Main Building
Location: All External Areas
Finding: Garden Bed/ Mulch - Conditions Conducive to Termites
Information: Mulch were found around the property. These areas can include untreated timber, and with a combination of moisture from watering hosing can make conditions conducive to termite activity and termite ingress.







Finding 6.03

Building:	Main Building
Location:	All External Areas
Finding:	In ground contact
Information:	Any timbers in direct ground contact provide opportunity for concealed termite entry and are likely to be subject to premature rot and decay as the soil retains moisture or damp conditions against the timbers.

Remove untreated timber that is in direct contact with external grounds. Consider replacement with more durable materials i.e. treated timber or non timber elements. Frequent pest inspections are advised to readily identify any termite activity in these areas.

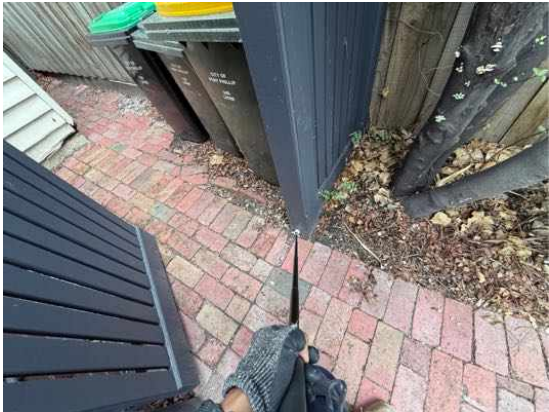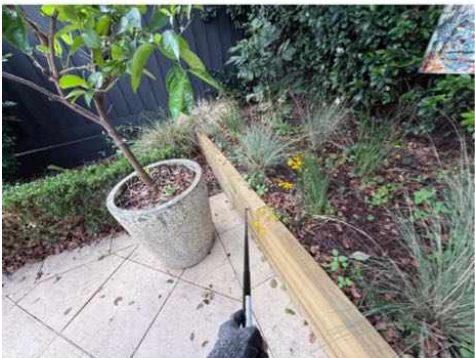

Finding 6.04

Building: Main Building
Location: Exterior walls - right side
Finding: Hot water relief valve not connected to drainage.
Information: Hot water relief valve is discharged inappropriately. Because of which, base perimeter can become excessively damp, potentially creating an environment that is susceptible to rust and corrosion of surrounding building elements, as well as attracting termites and other pests.

It is highly recommended that a plumber be appointed to install adequate drainage equipment where necessary.



Finding 6.05

Building: Main Building

Location: Roof Exterior

Finding: Gutters - Blocked

Information: Roof plumbing structures, such as guttering and downpipes, should be free of all debris to prevent blockages. Blockages of the guttering and downpipes will lead to pooling and accumulated water overflows, which is likely to subsequently flood eaves and exterior walls.

Where gutter guard is installed regular maintenance should include cleaning out any debris which may rest on top of or filter through the gutter guard.

Blocked gutters are likely to lead to high levels of moisture in the affected areas. Such moisture will not only cause rust and decay of the associated building materials, but can also provide conditions that are conducive to termite and timber pest activity. Blockages in gutters should therefore be removed immediately to ensure dry conditions are maintained.

Consult a Licensed Plumber for further specific advice on remedial works that may be required. In the interim, it is highly advised that blocked gutters be removed by the homeowner or a general handyperson as a matter of urgency.





Finding 6.06

Building: Main Building
 Location: Exterior walls - right side
 Finding: Timber deck- High conducive condition.
 Information: We are unable to inspect under the timber deck if its in close proximity to the ground.

Where we are unable to inspect timber structures, decks and subfloor areas the risk of undetected termite activity is rated as extremely High.

We strongly recommend the purchaser prioritise a termite treatment by a Licensed Pest Controller to protect and maintain the asset as it is a timber structure.



Evidence of fungal decay activity and/or damage

Finding 7.01

Building:	Main Building
Location:	Exterior walls - right side
Finding:	Wood rot
Information:	These building elements shows evidence of wood rot. Wood rot, also known as Fungal Decay, occurs when timbers and other cellulose building materials are exposed to damp conditions on an ongoing basis. This could be the result of exposure to weathering over a prolonged period of time, or the attraction of excessive moisture from other abutting building materials. Contributing factors also include poor air ventilation in the area.

Wood rot is often associated with general damp problems and is evidenced by a 'musty' smell or mould and mildew occurring on surfaces. If left unmanaged, damp conditions can lead to further health problems and the decay of timbers will continue. This also creates a huge conducive condition for termites.

Early intervention and regular maintenance, particularly of exterior timbers, will prolong the useful life of these building elements. Prior to any works being performed, the cause of the moisture that has created the visible wood rot should be identified and addressed in a suitable manner. Replacement of affected timbers may then be a necessary step in protecting surrounding building elements from such deterioration.

A qualified plumber may be appointed to assess the cause of excessive moisture and to provide advice on any remedial works as required. A qualified carpenter or registered builder may also be required to replace affected building materials.









Evidence of wood borer activity and/or damage

No evidence was found

Section D Significant Items

D4 Further Inspections

We advise that you seek additional specialist inspections from a qualified and, where appropriate, licensed

- As identified in summary and defect statements

Jim's Building Inspections can put you in contact with qualified and licensed providers of these and other trades services. Please contact your inspector for recommendations, or visit www.jims.net.

D5 Conclusion - Assessment of overall condition of property

- The inspected property was found to be in a fair condition when compared to other properties of similar age. As it had a major & few minor defects, most of which are expected to be found in a property of this age. Couple of moderately significant defects were also present.

Most of the defects could be mended by a building maintenance provider & its suggested to appoint licensed practitioners at recommended areas.

Some of the minor defects mentioned in the report when combined together, lead to one problem: Moderate amount moisture damaging/affecting neighbouring building elements & creating conditions which are conducive towards termite activity.

Due to recent renovations, majority of the defects if present gets obscured beneath the revamped work. Once the property is occupied, all areas should be monitored for a period of 12-24 months to lookout for any arising defects. If staining or cracking is noticed extensively in that period, always consult your building inspector.

The following building elements should be regularly monitored to identify any upcoming defects.

- 1) External facade- increase in cracks/ mortar deterioration.
- 2) Internal plasterboard wall & ceiling- for cracking (increase in quantity or length of cracks).
- 3) Eaves & Internal ceiling for water staining.
- 4) All tiled area- crack between grouts.
- 5) Uneven flooring- increase in subsidence.

No live termites were identified at the time of inspection. Conducive conditions for timber pests were found around the dwelling at the time of inspection.

As there is no durable notice found to indicate any previous termite management system installation and the property is considered highly susceptible to timber pests. It is highly recommended that the client to consult with a licensed pest controller to discuss the further preventative actions such as installation of an appropriate termite protection system.

For further information, advice and clarification please contact Shubham Patil on: 0452 035 252

Section D Significant Items

The following items were noted as - For your information

Noted Item

Building: Main Building
Location: All Areas
Finding: Termite Techniques
Information: All areas of the dwelling are checked with particular attention paid to wet areas which were closely assessed to check for excessive levels of moisture and temperature anomalies.


No evidence of termite activity was found inside the house at the time of the inspection.


In an attempt to identify the presence of hidden timber pest activity, a variety of techniques are adopted to identify irregularities including, a moisture meter reading of susceptible areas, sounding of timber elements using a device called a "donga" visual assessment of materials affected by moisture or signs of deformity, trails and bridging constructed by termites, irregular and regular shaped holes in timber elements indicating pest destruction.

Termite activity generates high temperatures and moisture and if this irregularity is found it can be grounds for further investigation.

Wall paneling, wallpaper, carpet and fixed cabinetry can obscure termite activity.



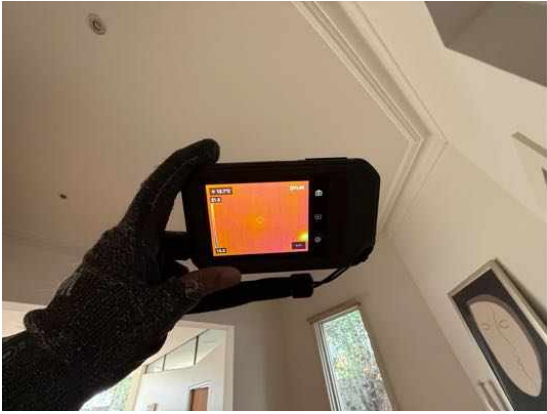

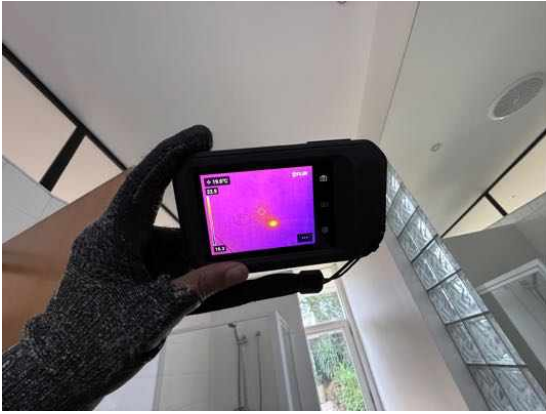

Noted Item

Building: Main Building
 Location: All Areas
 Finding: Evidence of recent renovations.
 Information: Whenever a property is refurbished, majority of the defects if present could get obscured beneath the revamped work. The same can be said for this property as well. Some fine cracks are filled over, walls have been painted etc. It is difficult to pinpoint on any particular defects present below such layers.

Once the property is occupied, all areas should be monitored for a period of 12-24 months to lookout for any arising defects. If staining or cracking is noticed extensively in that period, always consult your building inspector.




Noted Item

Building: Main Building
 Location: All Areas
 Finding: Additional photos & Obstruction/Limitations.
 Information: Additional photos for general documentation. May have some minor maintenance items not listed in the defects section.

Furthermore, some photographs are an indication of the obstructions and limitations which impeded full inspection of the property at the time of inspection. These obstructions can hide an array of defects and should be removed to allow full


inspection to be carried out. A re-inspection is recommended once the areas are made accessible.

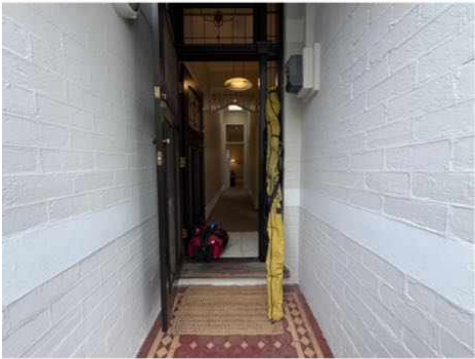







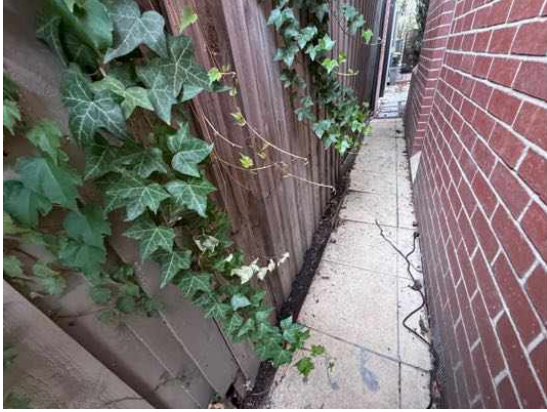















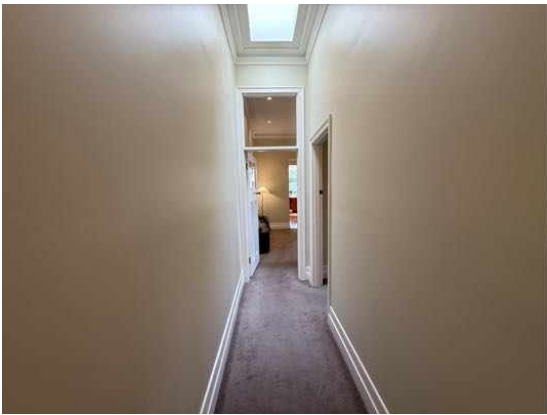

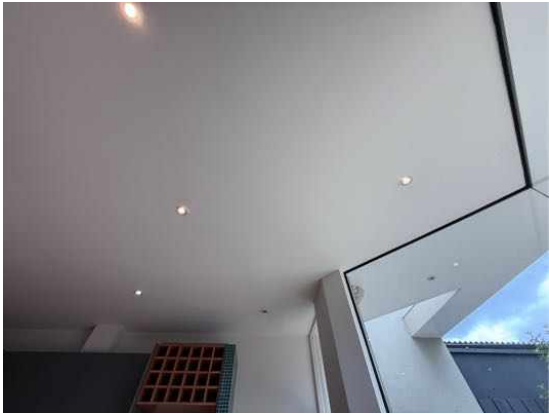









Definitions to help you better understand this report

Access hole (cover)	An opening in flooring or ceiling or other parts of a structure (such as service hatch, removable panel) to allow for entry to carry out an inspection, maintenance or repair.
Accessible area	An area of the site where sufficient, safe and reasonable access is available to allow inspection within the scope of the inspection.
Appearance defect	Fault or deviation from the intended appearance of a building element.
Asbestos-Containing Material (ACM)	Asbestos-containing material (ACM) means any material or thing that, as part of its design, contains asbestos.
Building element	A portion of a building that, by itself or in combination with other such parts, fulfils a characteristic function. NOTE: For example supporting, enclosing, furnishing or servicing building space.
Client	The person or other entity for whom the inspection is being carried out.
Conditions Conducive to Termite Activity	Noticeable building deficiencies or environmental factors that may contribute to the presence of Termites.
Defect	Fault or deviation from the intended condition of a material, assembly, or component.
Detailed assessment	An assessment by an accredited sampler to determine the extent and magnitude of methamphetamine contamination in a property.
Inspection	Close and careful scrutiny of a building carried out without dismantling, in order to arrive at a reliable conclusion as to the condition of the building.
Inspector	Person or organisation responsible for carrying out the inspection.
Instrument Testing	Where appropriate the carrying out of Tests using the following techniques and instruments: (a) electronic moisture detecting meter - an instrument used for assessing the moisture content of building elements (b) stethoscope - an instrument used to hear sounds made by termites within building elements (c) probing - a technique where timber and other materials/areas are penetrated with a sharp instrument (e.g. bradawl or pocket knife), but does not include probing of decorative timbers or finishes, or the drilling of timber and trees and (d) sounding - a technique where timber is tapped with a solid object. (e) T3I - an instrument used to detect movement, moisture and changes in temperature within timber
Limitation	Any factor that prevents full or proper inspection of the building.
Major defect	A defect of sufficient magnitude where rectification has to be carried

	out in order to avoid unsafe conditions, loss of utility or further deterioration of the property.
Methamphetamine	An amphetamine-type stimulant that is highly addictive. Methamphetamine is a controlled substance, classified as a Class A (very high-risk) drug under the Misuse of Drug Act. This term is used as a grouping term to include all substances screened for, specifically: Ephedrine, Pseudoephedrine, Amphetamine, Methamphetamine, MDA and MDMA.
Methamphetamine contamination	A property or part of a property where the level of methamphetamine has been tested in accordance with this standard and found to exceed 0.5 micrograms/100 cm ² (Residential) or 10 micrograms/100 cm ² (Commercial).
Methamphetamine production/manufacture	The manufacture of methamphetamine, including processing, packaging, and storage of methamphetamine and associated chemicals.
Minor defect	A defect other than a major defect.
Roof space/Roof void	Space between the roof covering and the ceiling immediately below the roof covering.
Screening assessment	An assessment by a screening sampler to determine whether or not methamphetamine is present.
Serviceability defect	Fault or deviation from the intended serviceability performance of a building element.
Significant item	An item that is to be reported in accordance with the scope of the inspection.
Site	Allotment of land on which a building stands or is to be erected.
Structural defect	Fault or deviation from the intended structural performance of a building element.
Structural element	Physically distinguishable part of a structure. NOTE: For example wall, columns, beam, connection.
Subfloor space	Space between the underside of a suspended floor and the ground.
Subterranean Termite Management Proposal	A written proposal in accordance with Australian Standard AS 3660.2 to treat a known subterranean termite infestation and/or manage the risk of concealed subterranean termite access to buildings and structures.
Termites	Wood destroying insects belonging to the order 'Isoptera' which commonly attack seasoned timber.
Tests	Additional attention to the visual examination was given to those accessible areas which the consultant's experience has shown to be

particularly susceptible to attack by Termites. Instrument Testing of those areas and other visible accessible timbers/materials/areas showing evidence of attack was performed.

Timber Pest Activity	Tell-tale signs associated with 'active' (live) and/or 'inactive' (absence of live) Timber Pests at the time of inspection.
Timber Pest Attack	Timber Pest Activity and/or Timber Pest Damage.
Timber Pest Damage	Noticeable impairments to the integrity of timber and other susceptible materials resulting from an attack by Timber Pests.
Urgent and Serious Safety Hazards	Building elements or situations that present a current or immediate potential threat of injury or disease to persons.

Terms on which this report was prepared

This report is based on the condition of the property at the time of inspection. We strongly recommend re-inspection 30 days after this report is issued as the general condition of the property is likely to have changed, including the extent of defects described and instance of potential undetected defects.

This report has been prepared in accordance with and subject to the pre-inspection agreement in place between the parties, which forms part of this Report.

This Report is prepared for the client identified above and may not be relied on by any other person without our express permission or by the purchase of this Report on our website.

SPECIAL ATTENTION SHOULD BE GIVEN TO THE SCOPE, LIMITATIONS AND EXCLUSIONS IN YOUR PRE-INSPECTION AGREEMENT AND THIS REPORT

Any of the exclusions or limitations identified for this Report may be the subject of a special-purpose inspection which we recommend being undertaken by an appropriately qualified inspector

RELIANCE AND DISCLOSURE

This report has been prepared based on conditions at the time of the report.

We own the copyright in this report and may make it available to third parties.

If your Property is in the Australian Capital Territory, you acknowledge we will make certain information about this Report available to the ACT Government for inclusion in the building and pest inspections public register if required under the *Civil Law (Sale of Residential Property) Act 2003*. This will include the fact the report has been prepared, the Property street address, date of the inspection, the name of the person who prepared the report and (if applicable) the entity that employs them.

UNDETECTED DEFECT RISK RATING

If this Report has identified a medium or high-risk rating for undetected defects, we strongly recommend a further inspection of areas that were inaccessible. This may include an invasive inspection that requires the removal or cutting of walls, floors or ceilings.

If the Property has been vacant for a period of time, moisture levels or leaks may not be detectable at the time of the inspection because often only frequent use of water pipes (showers, taps etc) result in a leak being identifiable. We advise further testing on pipes and water susceptible areas (such as the bathroom and laundry) after more frequent use has occurred.

IMPORTANT SAFETY INFORMATION:

This is not a report by a licensed plumber or electrician. We recommend a special-purpose

report to detect substandard or illegal plumbing and electrical work at the Property

This is not a smoke alarm report. We recommend all existing detectors in the Property be tested and advice sought as to the suitability of number, placement and operation.

This is not an asbestos report. There are potential products in the Property containing asbestos that will not be identified in this report. In order to accurately identify asbestos, we recommend performing an asbestos inspection, particularly for buildings built prior to 1988.

This is not a report on safety glass. Glazing in older homes may not reflect current standards and may cause significant injury if damaged. Exercise caution around the glass in older homes.

This is not a report on window opening restrictions. We have not inspected window opening restrictors. Window openings in older buildings may not reflect current standards and can be a potential risk. Window opening restrictors are advised for all second story or above windows with sill heights below 900mm. Some states make this a mandatory requirement. Owners should enquire of their local and state requirements to ensure compliance.

This is not a report on pool safety. If a swimming pool is present it should be the subject to a special purpose pool inspection.

External Timber Structures - Balcony and Decks. It is strongly recommended that a Structural Engineer is required to assess distributed load capacity of external timber structures such as balconies and decks, alerting users of the load capacity. Regular maintenance and inspections by competent practitioners to assess the ongoing durability of exposed external timber structures are needed.

This is not a Group Titled Property Report as per AS4349.2. If you require a report for a Group Titled Property as per this standard, please seek a separate inspection for Group Titled Properties.

MOISTURE

The identification of moisture, dampness or the evidence of water penetration is dependent on the weather conditions at the time an inspection. The absence of dampness identified in this Report does not necessarily mean the Property will not experience some damp problems in other weather conditions or that roofs, walls or wet areas are watertight.

Where the evidence of water penetration is identified we recommend detailed investigation of waterproofing in the surrounding area monitoring of the affected area over a period of time to fully detect and assess the cause of dampness.

MAINTENANCE OF THE PROPERTY

This Report is not a warranty or an insurance policy against problems developing with the Property in the future. Accordingly, a preventative maintenance program should be implemented which includes systematic inspections, detection and prevention of issues. Please contact the inspector who carried out this inspection for further advice.

It is strongly advised that appropriate steps be taken to remove, rectify or monitor any evidence of

conditions conducive to timber pest activity. Undertaking thorough regular inspections at intervals not exceeding twelve months (or more frequent inspections where the risk of timber pest attack is high or the building type is susceptible to attack). To further reduce the risk of subterranean termite attack, implement a management program in accordance with Australian Standard AS3660. This may include the installation of a monitoring and/or baiting system, or chemical and/or physical barrier. However, AS3660 stresses that subterranean termites can bridge or breach barrier systems and inspection zones and those thorough regular inspections of the building are necessary.

NO CERTIFICATION

- a) The Property has been compared to others of a similar age, construction type and method that had an acceptable level of basic maintenance completed.
- b) We don't advise you about title, ownership or other legal matters like easements, restrictions, covenants and planning laws. None of our inspections constitutes approval by a Building Surveyor, a certificate of occupancy or compliance with any law, regulation or standard, including any comment on whether the Property complies with current Australian Standards, Building Regulations or other legislative requirements.

RECTIFICATION COSTS

We don't provide advice on the costs of rectification or repair unless specifically identified in the scope of the Report. Any cost advice provided verbally or in this report must be taken as of a general nature and is not to be relied on. Actual costs depend on the quality of materials, the standard of work, what price a contractor is prepared to do the work for and may be contingent on approvals, delays and unknown factors associated with third parties. No liability is accepted for costing advice.