



Building and Timber Pest Inspection Report

Inspection Date: Wed, 1 Apr 2026

Property Address: 3/8A Clydesdale Drive, Upper Coomera
QLD 4209



Contents

	The Parties
Section A	Results of inspection - summary
Section B	General
Section C	Accessibility
Section D	Significant Items
Section E	Additional comments
Section F	Annexures to this report

Definitions to help you better understand this report

Terms on which this report was prepared

Special conditions or instructions

If you have any queries with this report or require further information, please do not hesitate to contact the person who carried out the inspection.

This Report has been prepared in accordance with the pre-inspection agreement in place between the parties set out below, which set out the purpose and scope of the inspection, and the significant items that will be reported on. This Report reflects the opinion of the inspector based on the documents that have been provided. This Report should be read in its entirety and in the context of the agreed scope of Services. If there is a discrepancy between the summary findings and the body of the Report, the body of the Report will prevail. We recommend that you should promptly implement any recommendation or advice in this Report, including recommendations of further inspections by another specialist. If you have any queries with this Report or require further information, please do not hesitate to contact the person who carried out the inspection. This Report contains reference to material that is the copyright of Standards Australia reproduced under agreement with SAI Global to Jim's Building Inspections (Australia).

Original Inspection Date: Wed, 1 Apr 2026

The Parties

Name of the Client:

Name of the Principal(if Applicable):

Job Address: 3/8A Clydesdale Drive, Upper Coomera QLD 4209

Client's Email Address:

Client's Phone Number:

Consultant: Tony Winders Ph: 0419 662 882
Email: Ashmore@jimsbuildinginspections.com.au

QBCC 1149244

Company Name: Jim's Building Inspections Ashmore

Company Address and Postcode: Chirn Park 4215

Company Email: Ashmore@jimsbuildinginspections.com.au

Company Contact Numbers: 0419 662 882

Special conditions or instructions

A report may be conditional on information provided by the person, agents or employees of the person requesting the report, apparent concealment of possible defects and a range of other factors

The following apply: Not Applicable

Section A Results of Inspection - summary

A summary of your inspection is outlined below; please also refer to the Report.

	Found	Not Found
Safety Hazard		✓
Major Defect		✓
Minor Defect	✓	
Live Timber Pest Activity		✓
Timber Pest Damage		✓
Conditions Conducive to Timber Pest Activity	✓	
Evidence of fungal decay activity and/or damage		✓
Evidence of wood borer activity and/or damage		✓
Evidence of a previous termite management program	✓	

Overall Condition (Building)

In summary, the building, compared to others of similar age and construction is in good condition with some minor defects found.

Overall Condition (Timber Pest)

In summary, the building, compared to others of similar age and construction is moderately susceptible to timber pests. A current termite treatment is in place. Minimum 12 monthly inspections should be carried out.

Section B General

General description of the property

Building Type	Detached, Residential
Company or Strata title	Yes
Floor	Slab - Monolithic or Slab on Ground
Furnished	Unfurnished
No. of bedrooms	3
Occupied	Unoccupied
Orientation	West
Other Building Elements	Driveway, Fence - Post and Rail Construction, Footpath
Other Timber Bldg Elements	Architraves, Door Frames, Doors, Skirting Boards
Roof	Pitched, Tiles, Timber Framed
Storeys	Single
Walls	Brick Veneer (Timber Framed), Rendered
Weather	Fine

Section C Accessibility

Areas Inspected

The following areas were inspected. As documented in your Pre-Inspection Agreement, obstructions and limitations to the accessible areas for inspection are to be expected in any inspection. Refer also to our listing of obstructions and limitations.

- Fencing
- Exterior
- Interior
- Gardens
- Roof Exterior - Part
- Roof Void - Part
- Landscaping Timbers
- The Site
- Trees
- Wall Exterior

The inspection excludes areas which are affected by obstructions, where access is limited or unsafe. We do not move obstructions and defects, timber pest activity or conditions conducive to these may not be obvious unless they are removed.

Inaccessible Areas

The following areas were inaccessible:

- Areas of low roof pitch preventing full inspection.
- Ceiling Cavity - Part.
- Roof Exterior - Part
- Outside of the fencing.
- Wall exterior due to obstructions.

Any areas which are inaccessible at the time of inspection present a high risk for undetected defects and timber pest activity and conditions conducive to these. The client is advised to make inaccessible areas accessible wherever possible for re-inspection.

Obstructions and Limitations

Building defects, termite and timber pest activity as well as conditions conducive to both, may be concealed by the following obstructions which prevented full inspection:

- Above safe working height
- Areas of low roof pitch preventing full inspection
- Appliances and equipment
- Ceiling linings
- Evidence of recently painted walls or ceilings
- Insulation
- Fixed Furniture - Built-in Cabinetry
- Floor coverings
- No power or light globes on site
- Solar Panels
- Stored items
- Vegetation
- Wall linings

The presence of obstructions increases the risk of undetected building defects, timber pest activity and conditions conducive to these. The client should make arrangement to remove obstructions where ever possible and re-inspect these areas urgently.

Undetected defect risk (Building)

A risk rating is provided to help you understand the degree to which accessibility issues and the presence of obstructions have limited the scope of the inspection

The risk of undetected defects is: **Medium**

When the risk of undetected defects is medium or high we strongly recommend further inspection once access is provided or if the obstruction can be removed. Contact us for further advice.

Undetected defect risk (Timber Pest)

A risk rating is provided to help you understand the degree to which accessibility issues and the presence of obstructions have limited the scope of the inspection

The risk of undetected defects is: **Medium**

When the risk of undetected defects is medium or high we strongly recommend further inspection once access is provided or if the obstruction can be removed. Contact us for further advice.

Section D Significant Items

Safety Hazard

No evidence was found

Major Defect

No evidence was found

Minor Defect

Finding 3.01

Building: Main Building
Location: Driveway > Ground Level
Finding: Cracking in concrete slab - Category 1
Information: Cracking coded as Category 1 was identified in the driveway and footpaths concrete slabs. A Category 1 crack is described as a fine but noticeable crack, with the slab at an otherwise reasonable level.

To be considered Category 1, the approximate width of the crack is less than 1.0mm, or a less than 10mm change in offset when a 3m straight edge is placed over the defect.

Category 1 cracks should be monitored for a period of 12 months. At the end of the monitoring period, identified cracks that are rated greater than Category 2 are considered defects, and require rectification.

Monitoring of all cracking should be conducted frequently. Always contact a building inspector should cracks widen, lengthen, or become more numerous.





Finding 3.02

Building: Main Building
 Location: Exterior walls - front > Front Right
 Finding: Stormwater pipe - Damaged
 Information: The down pipe to the front right side exterior wall of the building has suffered damage. The level of damage appears consistent with impact.

A licensed plumber or general handyman could be appointed to repair/replace the down pipe at the clients discretion.



Finding 3.03

Building: Main Building
 Location: Exterior walls - right side > Centre Right
 Finding: Stormwater Grate
 Information: The stormwater grate cap to the hot water service overflow pipe on the right side of the building was missing at the time of inspection.

It is recommended that a general handyman be appointed to replace the stormwater line grate cap as necessary, to help prevent any potential stormwater line blockages.



Finding 3.04

Building: Main Building
 Location: Roof Exterior > Existing
 Finding: Roof tiles - Weathered
 Information: Upon inspection of the exterior roofing, the majority of roof tiles were considered to be in a fair condition, with evidence of minor cracking and previous repair work to roof areas. While weathering of the tiles is consistent with the age of the property, maintenance works will likely be required.

Re-pointing and re-sealing the roof tiles should be considered by the client to help preserve and extend the life span of the tiles.

The client should consult a roofing contractor to gain advice on costs of any remedial works that may be required in the short to medium term. Remedial works are likely to increase the longevity of the exterior roofing structure.





Finding 3.05



Building:	Main Building
Location:	Hallway > Centre
Finding:	Cracking - Ceiling
Information:	There is cracking to an area of the hallway ceiling.

The cracking appears minor in nature and is generally only ever an appearance defect. While such cracking may be noticeable in some cases, it is quite common and does not indicate any structural damage.

Cracking of this nature can generally be repaired with minor sanding, filling and/or repainting. Such works should be performed by a qualified painter or a general

handyman.

Monitoring of all cracking should be conducted frequently. Always contact a building inspector should cracks widen, lengthen, or become more numerous.

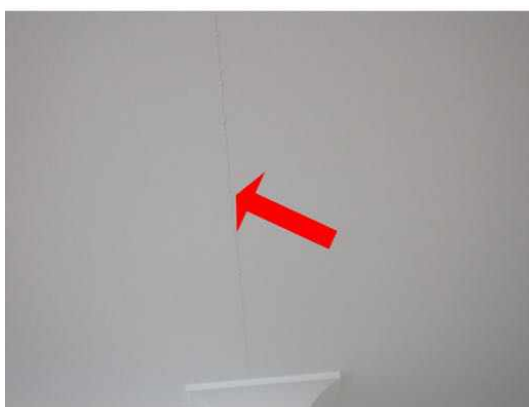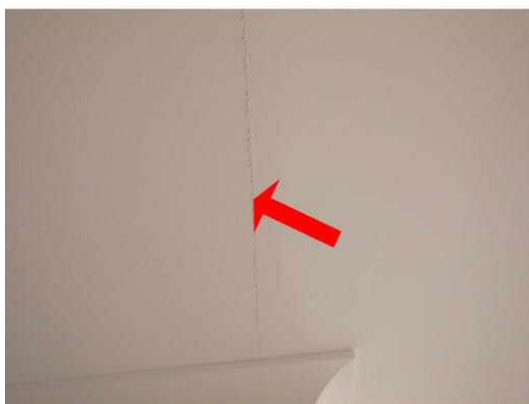

Finding 3.06

Building:	Main Building
Location:	Study > Front
Finding:	Door - Missing
Information:	The doors to study area opening were missing at the time of inspection. It appeared the doors have been previously removed (reasons unknown).

Although some building elements may seem irrelevant or unnecessary, all building elements play a key role in the operation and function of the overall structure and its performance.

A qualified carpenter or general handyman could be appointed to reattach the doors. These works should be conducted at the clients discretion.

Note - The missing doors may be stored in the garage area, at the time of inspection.




Finding 3.07

Building:	Main Building
Location:	Laundry > Rear
Finding:	Door - Stiff to slide
Information:	The aluminium sliding door to the laundry area was difficult to operate at the time of the inspection. Doors provide ventilation to the adjoining area and should be at a fully operational level to ensure user comfort. Restricted function of the door may also pose as a potential safety hazard if required for emergency egress from the building.

Generally, factors such as general age of the building element and a lack of maintenance are the usual causes for this type of defect.

An aluminium sliding door service agent may be required to repair/replace the affected door rollers.

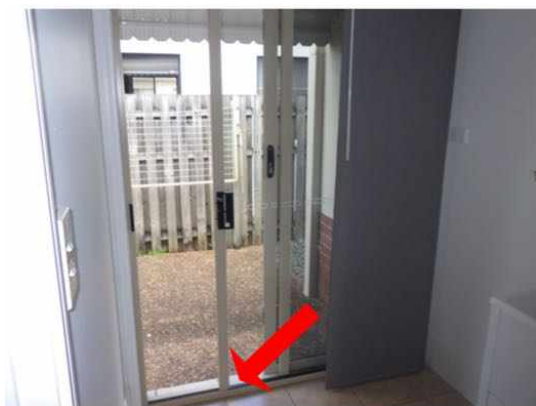

Finding 3.08

Building:	Main Building
Location:	Bathroom > Rear Right
Finding:	Cabinetry - Drawers jamming
Information:	The bathroom cabinetry bottom drawer was found to be sticking or jamming at the time of inspection. The sticking or jamming drawer detract from the operational state of the cabinetry. To improve operation of the affected drawer, a general handyman may be appointed to repair the affected drawer. Such works should be completed at discretion of the client.



Finding 3.09

Building:	Main Building
Location:	Bedroom 2 > Rear Left
Finding:	Wood Rot
Information:	At the time of inspection the bottom of the left side timber reveal and sill to the bedroom 2 area aluminium sliding window was soft to touch and showed signs of wood rot. The wood rot damage appears to be caused from excessive moisture, possibly from water tracking along the sliding window track.

The client could engage a qualified carpenter to investigate further and/or undertake rectification work as required.



Finding 3.10

Building: Main Building

Location: Bedroom 2 > Centre,Rear

Finding: Window - Stiff to Slide

Information: The aluminium sliding window in bedroom 2 was stiff to operate at the time of the inspection. Windows provide ventilation to the adjoining area and should be at a fully operational level to ensure user comfort. Restricted function of the window may also pose as a potential safety hazard if required for emergency egress from the building.

Generally, factors such as general age of the building element and a lack of maintenance are the usual causes for this type of defect.

An aluminium window service agent will be required to repair the affected windows.



Finding 3.11

Building: Main Building

Location: Bedroom - Master > Front


Finding: Door - Binding/Jamming

Information: Binding and/or jamming of the main bedroom door on the door frame was evident during standard operation. This defect inhibits the functionality of affected door as well

as creating potential for secondary defects to associated building elements, such as damage to the door framing.

A door that binds to the associated door frame or sill may have several causes, such as poor installation of the door or deteriorated hinges.

A qualified carpenter or general handyperson could be appointed to perform minor rectification works at client discretion.

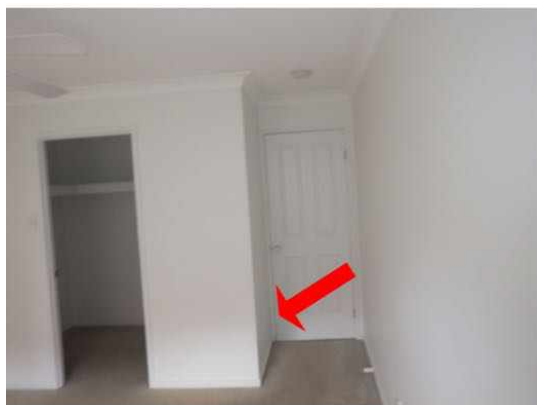

Finding 3.12

Building:	Main Building
Location:	Walk In Robe > Front
Finding:	Door - Missing
Information:	The door to the main bedroom/walk in robe opening was missing at the time of inspection. It appeared the door has been previously removed (reasons unknown).

Although some building elements may seem irrelevant or unnecessary, all building elements play a key role in the operation and function of the overall structure and its performance.

A qualified carpenter or general handyman could be appointed to reattach a door. These works should be conducted at the clients discretion.

Note - The missing door may be stored in the garage area, at the time of inspection.



Finding 3.13

Building:	Main Building
Location:	Ensuite > Front Left
Finding:	Shower damp - Monitor
Information:	Damp was evident to the lower 300mm of wall to the ensuite shower alcove at the time of inspection. There was no elevated moisture level readings around the tap area, and no elevated readings transferring to the other side of the wall in the areas where moisture readings were able to be obtained. Both sealant and grout appear in fair condition at present. Additionally, it was noted there appears to have been poorly applied previous repair work to the shower base silicone sealant.

It is recommended a sealant specialist is engaged to replace the shower base sealant and/or grout where required.

Monitoring the area is advised and if any visual signs of excessive moisture appear (peeling paint, mould) then consultation with a qualified plumber or bathroom specialist would be advised to identify the cause of damp and to perform remedial works as required.

Always ensure that sealant and grout is in good condition to prevent any moisture issues occurring in the future.





Finding 3.14

Building:	Main Building
Location:	Garage > Centre
Finding:	Cracking in concrete slab - Category 1
Information:	Cracking coded as Category 1 was identified in the garage floor concrete slab. A Category 1 crack is described as a fine but noticeable crack, with the slab at an otherwise reasonable level.

To be considered Category 1, the approximate width of the crack is less than 1.0mm, or a less than 10mm change in offset when a 3m straight edge is placed over the defect.

Category 1 cracks should be monitored for a period of 12 months. At the end of the monitoring period, identified cracks that are rated greater than Category 2 are considered defects, and require rectification.

Monitoring of all cracking should be conducted frequently. Always contact a building inspector should cracks widen, lengthen, or become more numerous.



Finding 3.15

Building:	Main Building
Location:	Garage > Front Left,Front Right
Finding:	Cracking - wall internal corner
Information:	There is timber trim missing and cracking to the wall internal corners both sides of the garage door opening.

The cracks appear minor in nature and generally are only ever an appearance defect. While such cracking may be noticeable in some cases, it is quite common and does not indicate any structural damage.

Cracking of this nature can generally be repaired with minor sanding, filling and/or repainting. Such works should be performed by a qualified painter or a general handyman.

Monitoring of all cracking should be conducted frequently. Always contact a building inspector should cracks widen, lengthen, or become more numerous.



Finding 3.16

Building:	Main Building
Location:	Attic > Centre
Finding:	Skylight - Damaged/blocked shaft
Information:	It was noted at the time of inspection that the skylight shaft in the ceiling space has been blocked/damaged, and is therefore not fully functional.

While seemingly minor, skylights allow natural light to filter into the surrounding area. Without such light, the area may be susceptible to the formation and development of mould, which creates a respiratory health hazard for all persons that come into contact with the area.


Where the skylight shaft has been blocked (even partially) or damaged, it is recommended that a carpenter or general handyperson be appointed to perform rectification works as necessary.



Finding 3.17

Building: Main Building
Location: Internal Areas > Existing
Finding: Wear and Tear
Information: At the time of inspection the building interior showed signs of minor cracking and/or scuffing to floors, walls, ceilings and cornices (as per example photos).

The level of damage appears consistent with normal building movement and/or general wear and tear.

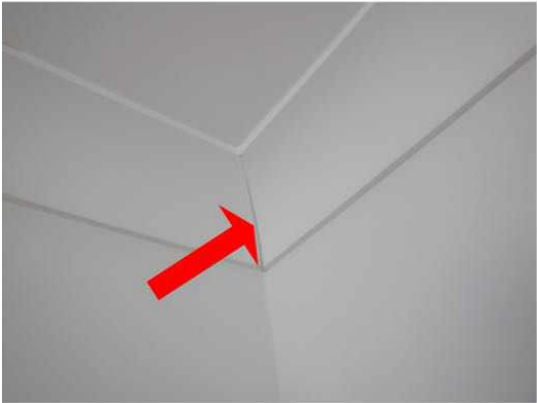



Live Timber Pest Activity

No evidence was found

Timber Pest Damage

No evidence was found

Conditions Conducive to Timber Pest Activity

Finding 6.01

Building: Main Building
 Location: Exterior walls - right side > Ground Level
 Finding: In ground - Timber
 Information: At the time of inspection there was timber on/in ground areas to the right side of the property.


Any timbers in direct ground contact provide opportunity for concealed termite activity and are likely to be subject to premature rot and decay as the soil retains moisture or damp conditions against the timbers.

Removal of any untreated timber or tree stumps which are in direct contact with external ground is recommended. Frequent pest inspections are advised to readily identify any termite activity in these areas.



Finding 6.02

Building: Main Building
 Location: Exterior walls - left side > Centre Left
 Finding: Overflow - Not plumbed for drainage
 Information: The air conditioning unit overflow on the left side of the property is not plumbed or connected to suitable drainage, which can result in the surrounding area becoming excessively damp. These damp conditions can lead to secondary defects such as rot, rust or corrosion of associated building elements, the formation of fungal decay, or even the creation of potential slip hazards. When coupled with poor site drainage, pooling of water may also attract termite activity to this area. It is highly recommended that a qualified plumber be appointed to install adequate drainage to the overflow. These works will ensure that the area remains dry and free of any secondary defects.

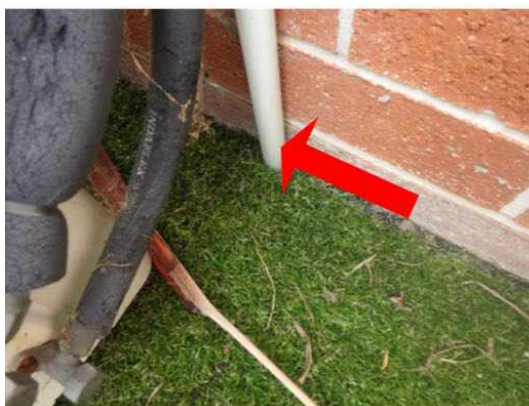

Finding 6.03

Building: Main Building
 Location: Yard - Back & Sides > Ground Level
 Finding: In ground contact
 Information: It was noted that the garden beds and finished ground levels cover the base of the timber fence palings (as per example photos).

Any timbers in direct ground contact provide opportunity for concealed termite entry and are likely to be subject to premature rot and decay as the soil retains moisture or damp conditions against the timbers.

Frequent pest inspections are advised to readily identify any termite activity in these areas.





Evidence of fungal decay activity and/or damage

No evidence was found

Evidence of wood borer activity and/or damage

No evidence was found

Section D Significant Items

D4 Further Inspections

We advise that you seek additional specialist inspections from a qualified and, where appropriate, licensed

- As identified in summary and defect statements

Jim's Building Inspections can put you in contact with qualified and licensed providers of these and other trades services. Please contact your inspector for recommendations, or visit www.jims.net.

D5 Conclusion - Assessment of overall condition of property

- The building compared to others of a similar age and construction appears to be in good condition.

It does however have some minor maintenance issues that will require attention. Left unmanaged some of these defects may become costly in the future and develop into more major defects over time. As noted in the report, no electrical fittings or fixtures were able to be tested at the time of inspection as there was no electrical power supply to the property.

At the time of inspection there was no timber termite activity found and evidence of a previously installed physical termite barrier was noted.

This system requires regular annual inspections.

The client is advised to make enquires with the seller or building complex's body corporate managers to ascertain the name of the termite barrier installation company, to verify any barrier details and/or maintenance requirements.

For further information, advice and clarification please contact Tony Winders on: 0419 662 882

Section D Significant Items

The following items were noted as - For your information

Noted Item

Building: Main Building
Location: Entry > Existing
Finding: No obvious defect
Information: No obvious defects found at the time of inspection.



Noted Item

Building: Main Building
Location: Living/Dining Room > Existing
Finding: No obvious defect
Information: No obvious defects found at the time of inspection.





Noted Item

Building: Main Building
Location: Kitchen > Existing
Finding: No obvious defect
Information: No obvious defects found at the time of inspection.



Noted Item

Building: Main Building
Location: Hallway > Existing
Finding: Additional Photos

Information: Additional photos are provided for your general reference



Noted Item

Building: Main Building
Location: Study > Existing
Finding: Additional Photos
Information: Additional photos are provided for your general reference



Noted Item

Building: Main Building

Location: Laundry > Existing
Finding: Additional Photos
Information: Additional photos are provided for your general reference



Noted Item

Building: Main Building
Location: Toilet (WC) > Existing
Finding: No obvious defect
Information: No obvious defects found at the time of inspection.




Noted Item

Building: Main Building

Location: Bathroom > Existing,Rear Left

Finding: Moisture Level Readings

Information: At the time of inspection the bathroom shower cubicle areas checked with the Tramex Moisture Meter returned low - normal moisture level readings.

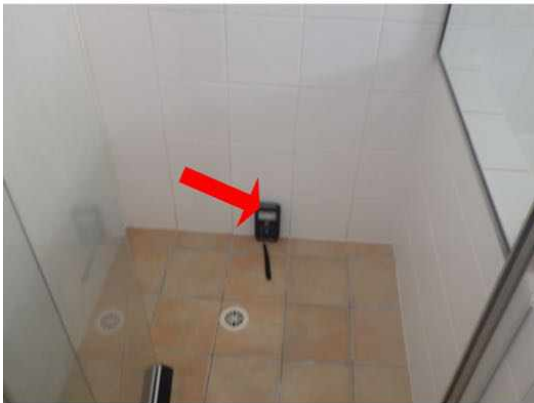



Noted Item

Building: Main Building
 Location: Bathroom > Existing
 Finding: Additional Photos
 Information: Additional photos are provided for your general reference



Noted Item


Building: Main Building
 Location: Linen Cupboard > Existing
 Finding: No obvious defect

Information: No obvious defects found at the time of inspection.



Noted Item

Building: Main Building
Location: Hallway > Existing
Finding: No obvious defect
Information: No obvious defects found at the time of inspection.

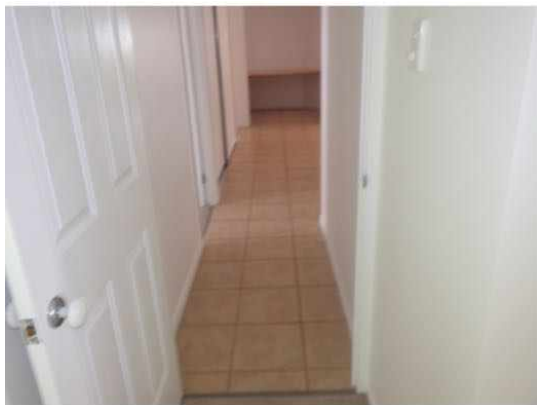

Noted Item

Building: Main Building

Location: Bedroom 2 > Existing
Finding: Additional Photos
Information: Additional photos are provided for your general reference



Noted Item

Building: Main Building
Location: Bedroom 3 > Existing
Finding: No obvious defect
Information: No obvious defects found at the time of inspection.





Noted Item

Building: Main Building
 Location: Bedroom - Master > Existing
 Finding: Additional Photos
 Information: Additional photos are provided for your general reference



Noted Item

Building: Main Building
 Location: Ensuite > Existing
 Finding: Additional Photos

Information: Additional photos are provided for your general reference



Noted Item

Building: Main Building
Location: Attic > Existing
Finding: Additional Photos
Information: Additional photos are provided for your general reference






Noted Item

Building: Main Building
Location: Internal Areas > Existing
Finding: Termitracker
Information: The termitracker itracker was positioned randomly to internal wall, timber skirting and window frame areas checking for signs of termite activity.

No activity was recorded at the time of inspection.



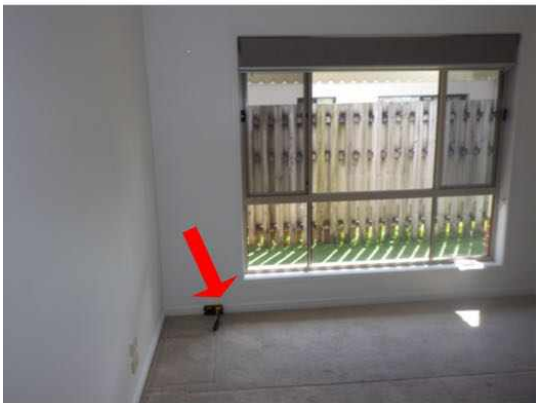



Noted Item

Building: Main Building
Location: External Areas > Existing
Finding: Additional Photos
Information: Additional photos are provided for your general reference






Noted Item

Building: Main Building
 Location: Internal Areas > Existing
 Finding: Electricity
 Information: At the time of inspection no electrical fixtures, fittings or appliances were able to be checked as there was no electricity supply to the property.

It is recommended the client seeks confirmation from the seller or sellers agent, all appliances, and electrical fittings and fixtures are operating and functioning as intended before the time of sale.

Alternatively a licensed electrician could be engaged to check all appliances and electrical fixtures at the clients discretion.



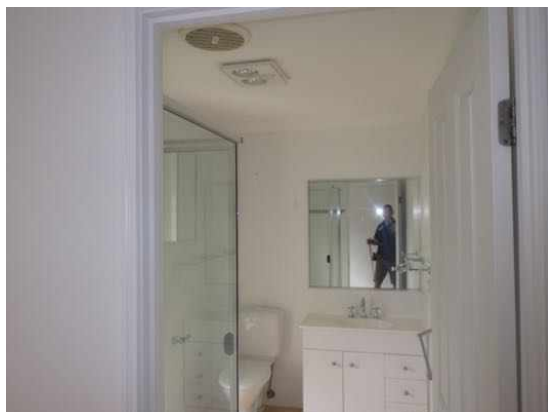

The following items were noted as - Evidence of a previous termite management program

Noted Item

Building:	Main Building
Location:	Exterior walls > Existing
Finding:	Evidence of a previous termite management system was identified
Information:	There are a number of factors which indicate the presence of a previously installed or applied termite barrier. The most common are a durable notice (to the inside of your meter box) observable physical barriers installed to building perimeter and in ground reticulation systems.

In this instance no durable notice was found inside the electrical meter box (although it may have deteriorated to an unreadable stage) but evidence of a previously installed physical barrier was observed, along with previous inspection notices inside the kitchen area under sink cabinetry, last dated 12/07/2008. This system requires regular annual inspections.

At the time of inspection it was suspected the physical barrier is a termiglass type barrier, possibly installed by the Termicide Group.???

Where a Termite Management System has been identified you should refer to the type

of barrier date of installation warranty conditions and any documentation provided by a past owner (if possible).

Alternatively the building complex body corporate managers may provide or have relevant information on any existing termite barrier and/or the barrier installation company details.

No evidence of regular or annual inspections was found.





Termiglass

The Termiglass Physical Termite Management System is Australia's number one non-toxic termite protection measure

Termiglass is proud to deliver environmentally preferable termite management solutions. The Termiglass Non-Toxic Physical Termite Management System was developed with the environment in mind, and is made from 100% recycled, locally sourced glass which is crushed to specifications formulated to be a shape and density that is too hard for them, too heavy to move, and too small to crawl for termites to pass through.

Used in conjunction with Termiglass Strip Shielding and Termiglass Pillars, the full Termiglass System forms a complete non-toxic physical termite management system to protect your home or building project from unwanted termite entry without the use of toxic and harmful chemicals. The Termiglass System has been successful in well over 200,000 installations since it's invention.

[Download the Termiglass Brochure](#)

[Download the Termiglass Accessories Brochure](#)



Definitions to help you better understand this report

Access hole (cover)	An opening in flooring or ceiling or other parts of a structure (such as service hatch, removable panel) to allow for entry to carry out an inspection, maintenance or repair.
Accessible area	An area of the site where sufficient, safe and reasonable access is available to allow inspection within the scope of the inspection.
Appearance defect	Fault or deviation from the intended appearance of a building element.
Asbestos-Containing Material (ACM)	Asbestos-containing material (ACM) means any material or thing that, as part of its design, contains asbestos.
Building element	A portion of a building that, by itself or in combination with other such parts, fulfils a characteristic function. NOTE: For example supporting, enclosing, furnishing or servicing building space.
Client	The person or other entity for whom the inspection is being carried out.
Conditions Conducive to Termite Activity	Noticeable building deficiencies or environmental factors that may contribute to the presence of Termites.
Defect	Fault or deviation from the intended condition of a material, assembly, or component.
Detailed assessment	An assessment by an accredited sampler to determine the extent and magnitude of methamphetamine contamination in a property.
Inspection	Close and careful scrutiny of a building carried out without dismantling, in order to arrive at a reliable conclusion as to the condition of the building.
Inspector	Person or organisation responsible for carrying out the inspection.
Instrument Testing	Where appropriate the carrying out of Tests using the following techniques and instruments: (a) electronic moisture detecting meter - an instrument used for assessing the moisture content of building elements (b) stethoscope - an instrument used to hear sounds made by termites within building elements (c) probing - a technique where timber and other materials/areas are penetrated with a sharp instrument (e.g. bradawl or pocket knife), but does not include probing of decorative timbers or finishes, or the drilling of timber and trees and (d) sounding - a technique where timber is tapped with a solid object. (e) T3I - an instrument used to detect movement, moisture and changes in temperature within timber
Limitation	Any factor that prevents full or proper inspection of the building.
Major defect	A defect of sufficient magnitude where rectification has to be carried

	out in order to avoid unsafe conditions, loss of utility or further deterioration of the property.
Methamphetamine	An amphetamine-type stimulant that is highly addictive. Methamphetamine is a controlled substance, classified as a Class A (very high-risk) drug under the Misuse of Drug Act. This term is used as a grouping term to include all substances screened for, specifically: Ephedrine, Pseudoephedrine, Amphetamine, Methamphetamine, MDA and MDMA.
Methamphetamine contamination	A property or part of a property where the level of methamphetamine has been tested in accordance with this standard and found to exceed 0.5 micrograms/100 cm ² (Residential) or 10 micrograms/100 cm ² (Commercial).
Methamphetamine production/manufacture	The manufacture of methamphetamine, including processing, packaging, and storage of methamphetamine and associated chemicals.
Minor defect	A defect other than a major defect.
Roof space/Roof void	Space between the roof covering and the ceiling immediately below the roof covering.
Screening assessment	An assessment by a screening sampler to determine whether or not methamphetamine is present.
Serviceability defect	Fault or deviation from the intended serviceability performance of a building element.
Significant item	An item that is to be reported in accordance with the scope of the inspection.
Site	Allotment of land on which a building stands or is to be erected.
Structural defect	Fault or deviation from the intended structural performance of a building element.
Structural element	Physically distinguishable part of a structure. NOTE: For example wall, columns, beam, connection.
Subfloor space	Space between the underside of a suspended floor and the ground.
Subterranean Termite Management Proposal	A written proposal in accordance with Australian Standard AS 3660.2 to treat a known subterranean termite infestation and/or manage the risk of concealed subterranean termite access to buildings and structures.
Termites	Wood destroying insects belonging to the order 'Isoptera' which commonly attack seasoned timber.
Tests	Additional attention to the visual examination was given to those accessible areas which the consultant's experience has shown to be

particularly susceptible to attack by Termites. Instrument Testing of those areas and other visible accessible timbers/materials/areas showing evidence of attack was performed.

Timber Pest Activity	Tell-tale signs associated with 'active' (live) and/or 'inactive' (absence of live) Timber Pests at the time of inspection.
Timber Pest Attack	Timber Pest Activity and/or Timber Pest Damage.
Timber Pest Damage	Noticeable impairments to the integrity of timber and other susceptible materials resulting from an attack by Timber Pests.
Urgent and Serious Safety Hazards	Building elements or situations that present a current or immediate potential threat of injury or disease to persons.

Terms on which this report was prepared

This report is based on the condition of the property at the time of inspection. We strongly recommend re-inspection 30 days after this report is issued as the general condition of the property is likely to have changed, including the extent of defects described and instance of potential undetected defects.

This report has been prepared in accordance with and subject to the pre-inspection agreement in place between the parties, which forms part of this Report.

This Report is prepared for the client identified above and may not be relied on by any other person without our express permission or by the purchase of this Report on our website.

SPECIAL ATTENTION SHOULD BE GIVEN TO THE SCOPE, LIMITATIONS AND EXCLUSIONS IN YOUR PRE-INSPECTION AGREEMENT AND THIS REPORT

Any of the exclusions or limitations identified for this Report may be the subject of a special-purpose inspection which we recommend being undertaken by an appropriately qualified inspector

RELIANCE AND DISCLOSURE

This report has been prepared based on conditions at the time of the report.

We own the copyright in this report and may make it available to third parties.

If your Property is in the Australian Capital Territory, you acknowledge we will make certain information about this Report available to the ACT Government for inclusion in the building and pest inspections public register if required under the *Civil Law (Sale of Residential Property) Act 2003*. This will include the fact the report has been prepared, the Property street address, date of the inspection, the name of the person who prepared the report and (if applicable) the entity that employs them.

UNDETECTED DEFECT RISK RATING

If this Report has identified a medium or high-risk rating for undetected defects, we strongly recommend a further inspection of areas that were inaccessible. This may include an invasive inspection that requires the removal or cutting of walls, floors or ceilings.

If the Property has been vacant for a period of time, moisture levels or leaks may not be detectable at the time of the inspection because often only frequent use of water pipes (showers, taps etc) result in a leak being identifiable. We advise further testing on pipes and water susceptible areas (such as the bathroom and laundry) after more frequent use has occurred.

IMPORTANT SAFETY INFORMATION:

This is not a report by a licensed plumber or electrician. We recommend a special-purpose

report to detect substandard or illegal plumbing and electrical work at the Property

This is not a smoke alarm report. We recommend all existing detectors in the Property be tested and advice sought as to the suitability of number, placement and operation.

This is not an asbestos report. There are potential products in the Property containing asbestos that will not be identified in this report. In order to accurately identify asbestos, we recommend performing an asbestos inspection, particularly for buildings built prior to 1988.

This is not a report on safety glass. Glazing in older homes may not reflect current standards and may cause significant injury if damaged. Exercise caution around the glass in older homes.

This is not a report on window opening restrictions. We have not inspected window opening restrictors. Window openings in older buildings may not reflect current standards and can be a potential risk. Window opening restrictors are advised for all second story or above windows with sill heights below 900mm. Some states make this a mandatory requirement. Owners should enquire of their local and state requirements to ensure compliance.

This is not a report on pool safety. If a swimming pool is present it should be the subject to a special purpose pool inspection.

External Timber Structures - Balcony and Decks. It is strongly recommended that a Structural Engineer is required to assess distributed load capacity of external timber structures such as balconies and decks, alerting users of the load capacity. Regular maintenance and inspections by competent practitioners to assess the ongoing durability of exposed external timber structures are needed.

This is not a Group Titled Property Report as per AS4349.2. If you require a report for a Group Titled Property as per this standard, please seek a separate inspection for Group Titled Properties.

MOISTURE

The identification of moisture, dampness or the evidence of water penetration is dependent on the weather conditions at the time an inspection. The absence of dampness identified in this Report does not necessarily mean the Property will not experience some damp problems in other weather conditions or that roofs, walls or wet areas are watertight.

Where the evidence of water penetration is identified we recommend detailed investigation of waterproofing in the surrounding area monitoring of the affected area over a period of time to fully detect and assess the cause of dampness.

MAINTENANCE OF THE PROPERTY

This Report is not a warranty or an insurance policy against problems developing with the Property in the future. Accordingly, a preventative maintenance program should be implemented which includes systematic inspections, detection and prevention of issues. Please contact the inspector who carried out this inspection for further advice.

It is strongly advised that appropriate steps be taken to remove, rectify or monitor any evidence of

conditions conducive to timber pest activity. Undertaking thorough regular inspections at intervals not exceeding twelve months (or more frequent inspections where the risk of timber pest attack is high or the building type is susceptible to attack). To further reduce the risk of subterranean termite attack, implement a management program in accordance with Australian Standard AS3660. This may include the installation of a monitoring and/or baiting system, or chemical and/or physical barrier. However, AS3660 stresses that subterranean termites can bridge or breach barrier systems and inspection zones and those thorough regular inspections of the building are necessary.

NO CERTIFICATION

- a) The Property has been compared to others of a similar age, construction type and method that had an acceptable level of basic maintenance completed.
- b) We don't advise you about title, ownership or other legal matters like easements, restrictions, covenants and planning laws. None of our inspections constitutes approval by a Building Surveyor, a certificate of occupancy or compliance with any law, regulation or standard, including any comment on whether the Property complies with current Australian Standards, Building Regulations or other legislative requirements.

RECTIFICATION COSTS

We don't provide advice on the costs of rectification or repair unless specifically identified in the scope of the Report. Any cost advice provided verbally or in this report must be taken as of a general nature and is not to be relied on. Actual costs depend on the quality of materials, the standard of work, what price a contractor is prepared to do the work for and may be contingent on approvals, delays and unknown factors associated with third parties. No liability is accepted for costing advice.